

CUT BANK, MONTANA

AL-484 (FAA)

25163

WAAS CH 99337 W32A	APP CRS 319°	Rwy Ldg TDZE Apt Elev	5300 3851 3858
--	------------------------	-----------------------------	---


RNAV (GPS) RWY 32
CUT BANK INTL (CTB)

T
A
-28°C


For uncompensated Baro-VNAV systems, LNAV/VNAV
NA below -25°C (-13°F) or above 51°C (124°F).
DME/DME RNP-0.3 NA.

MISSED APPROACH: Climb to 4400 then climbing right turn to 11000 direct WEBVO and hold.

ASOS 119.025	SALT LAKE CITY CENTER 133.4 285.4	UNICOM 123.0 (CTAF) 0
------------------------	---	---------------------------------

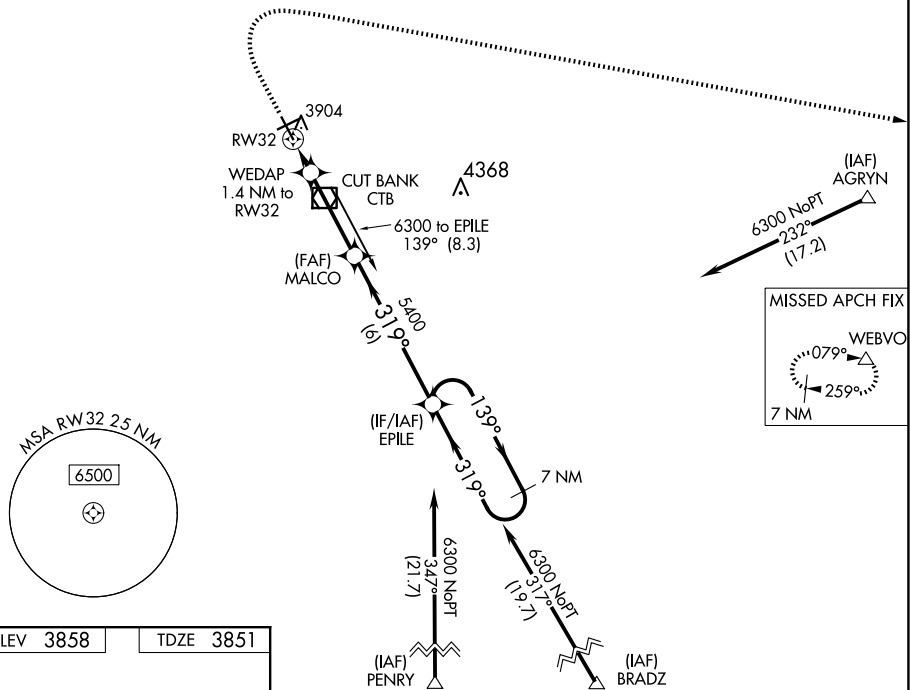

ELEV 3858		TDZE 3851
-----------	--	-----------

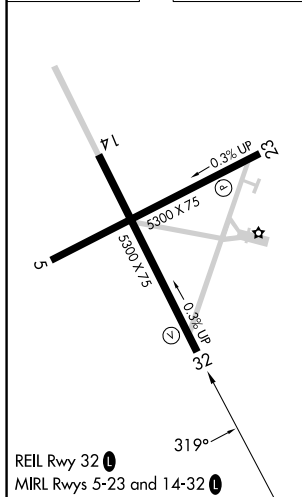

4400
↑

11000
↗

WEBVO
△

VGSi and RNAV glidepath not coincident
(VGSi Angle 3.00/TCH 42).

7 NM
Holding Pattern

EPILE

139° → 6300
← 319°

*INAV only

WEDAP
1.4 NM to RW32

*0.8 NM to RW32

RW32

4320*

5400

GP 3.00°
TCH 53

0.8 NM 0.6 NM 3.3 NM 6 NM

CATEGORY	A	B	C	D
LPV DA		4051-1	200 (200-1)	
INAV/DA		4101-1	250 (300-1)	
INAV MDA		4160-1	309 (400-1)	
C CIRCLING	4280-1 422 (500-1)	4320-1 462 (500-1)	4400-1½ 542 (600-1½)	4620-2½ 762 (800-2½)

CUT BANK, MONTANA
Orig-B 07DEC17

48°37'N-112°23'W

CUT BANK INTL (CTB)
RNAV (GPS) RWY 32

NW-1, 04 SEP 2025 to 02 OCT 2025

NW-1, 04 SEP 2025 to 02 OCT 2025