


TACAN RWY 13

TACAN CVS Chan 53	APCH CRS 120°	Rwy Idg 8194 TDZE 4294 Arpt Elev 4295	[USAF]	CANNON AFB (KCVS)
Missed approach requires use of RNAV or RADAR monitoring.			SSALR (A3)	MISSED APPROACH: Climb to 6000 out CVS TACAN R-130 to 5.6 DME (HOMEP) then turn right climbing to 7000 intercept CVS R-193 to 12 DME (CLINK) and hold.
▼ * When ALS inop, increase CAT AB vis to 1 mile, CAT CDE vis to 1¾ miles.				
ATIS 119.1 269.9	CANNON APP CON 118.425 352.1	CANNON TOWER 120.4 270.25	GND CON 121.9 275.8	CLNC DEL 120.2 293.225

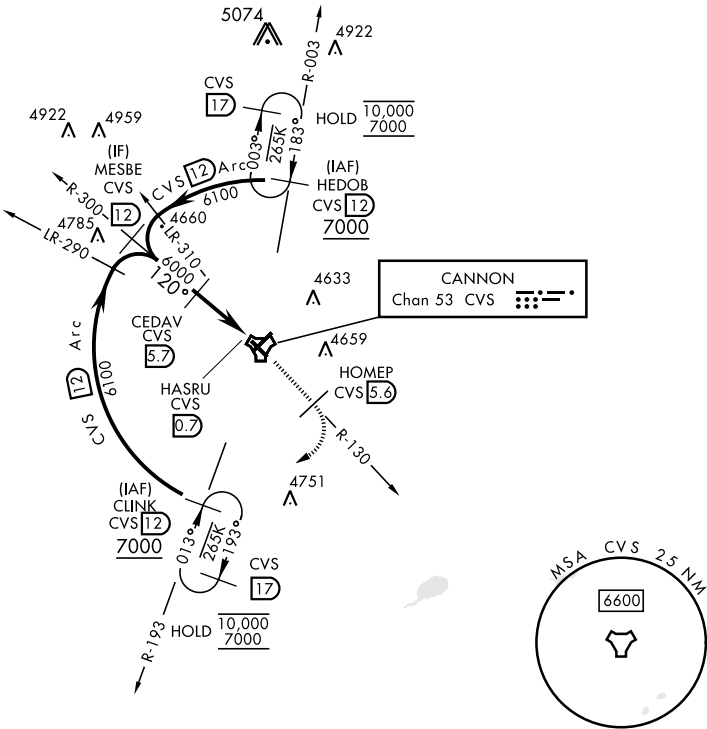

EMERG SAFE ALT 100 NM 9000

MESBE CVS 12 6100 120° 6000 3.13° TCH 37					6000 CVS R-130	HOMEP CVS 5.6	7000	CLINK CVS 12	ELEV 4295	TDZE 4294
CEDAV CVS 5.7 6000					CVS 2.1 HASRU CVS 0.7	CVS TACAN				
CATEGORY					5 NM 0.1					
A B C D E										
S-13*					4800-¾ 506 (600-¾) 4800-1 506 (600-1)					
CIRCLING					4840-1 545 (600-1) 4860-1½ 565 (600-1½) 5000-2¼ 705 (800-2¼) 5020-2½ 725 (800-2½)					
					HIRL all rwys					

TACAN RWY 13

SW-1, 04 SEP 2025 to 02 OCT 2025

SW-1, 04 SEP 2025 to 02 OCT 2025