


WAAS CH 90324 W34A	APP CRS 342°	Rwy Idg 5332 TDZE 135 Apt Elev 142
--	------------------------	---

RNAV (GPS) RWY 34

ARLINGTON MUNI (A WO)

RNP APCH-GPS.		MALS	MISSED APPROACH: Climb to 1000 then climbing left turn to 2000 direct SAVOY and hold.
⚠ Inop table does not apply to LPV. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1½ SM and LNAV Cat C and D visibility to 1½ SM.		Ⓜ	

AWOS-3PT 135.625	SEATTLE APP CON 128.5 306.9	CLNC DEL 121.725	CTAF 122.725 0
----------------------------	---------------------------------------	----------------------------	--------------------------

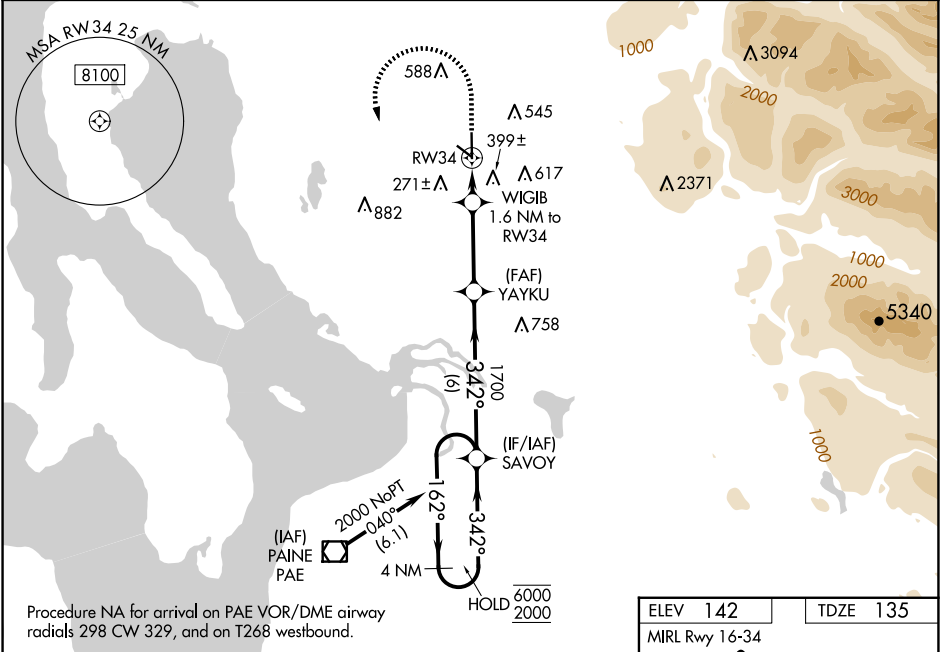

1000

↑

2000

↷

SAVOY

✦

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 36).

YAYKU

SAVOY

4 NM Holding Pattern

WIGIB

1.6 NM to RW34

1700

342°

162°

6000

2000

1700

RW34

680

GP 3.00°


TCH 46

1.6 NM

3.2 NM

6 NM

CATEGORY		A	B	C	D
LPV	DA	335-¾ 200 (200-¾)			
LNAV/VNAV	DA	510-¾ 375 (400-¾)			
LNAV	MDA	540-¾ 405 (400-¾)	540-1 405 (400-1)		
CIRCLING		840-1 698 (700-1)	900-1 758 (800-1)	1000-2½ 858 (900-2½)	1040-3 898 (900-3)

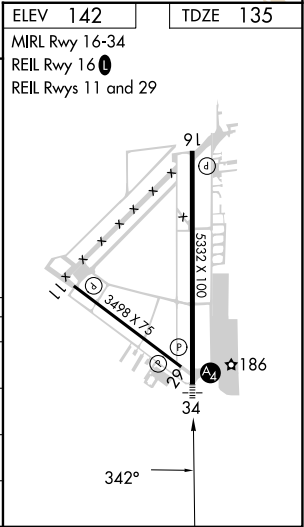

NW-1, 04 SEP 2025 to 02 OCT 2025

NW-1, 04 SEP 2025 to 02 OCT 2025