


|             |          |             |
|-------------|----------|-------------|
| APP CRS     | Rwy Ldg  | <b>7257</b> |
| <b>313°</b> | TDZE     | <b>36</b>   |
|             | Apt Elev | <b>36</b>   |

RNAV (RNP) Z RWY 31  
VALLEY INTL (HRL)

|                                                                                                                                                                                                                                                                   |                                             |                                                         |                                                                                   |                                                                    |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------|---------------------------------------------------------|-----------------------------------------------------------------------------------|--------------------------------------------------------------------|
| RNP AR APCH - GPS.                                                                                                                                                                                                                                                |                                             |                                                         |  | <b>MISSED APPROACH:</b><br>Climb to 2000 direct<br>CAKOB and hold. |
| <b>▼</b> For uncompensated Baro-VNAV systems, procedure NA below -1°C or above 54°C. For inop ALS, increase RNP 0.11 all Cats visibilities to 3/4 SM and increase RNP 0.30 all Cats visibilities 1/2 SM. When local altimeter setting not received, procedure NA. |                                             |                                                         |                                                                                   |                                                                    |
| <b>ATIS</b><br><b>124.85</b>                                                                                                                                                                                                                                      | <b>VALLEY APP CON</b><br><b>120.7 279.5</b> | <b>HARLINGEN TOWER ★</b><br><b>119.3 (CTAF) 0 317.6</b> | <b>GND CON</b><br><b>121.7</b>                                                    | <b>UNICOM</b><br><b>122.95</b>                                     |

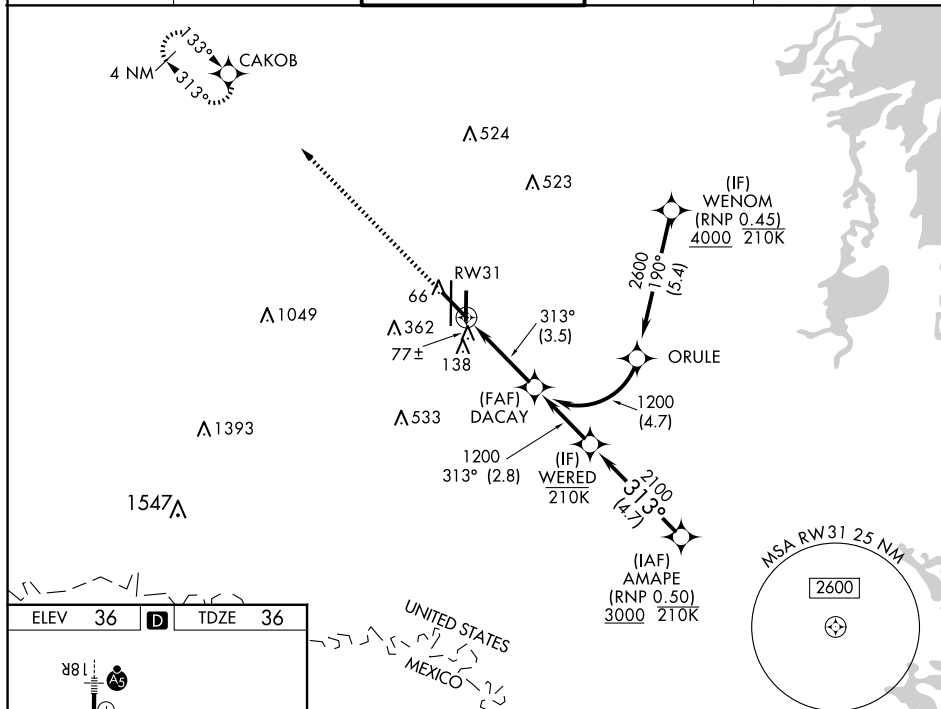

2000

CAKOB

See Planview for multiple IF locations.

DACAY

1200

1200

GP 3.00° TCH 55

RW31

313°

3.5 NM

| CATEGORY    | A | B       | C             | D |
|-------------|---|---------|---------------|---|
| RNP 0.11 DA |   | 286-1/2 | 250 (300-1/2) |   |
| RNP 0.30 DA |   | 339-1/2 | 303 (400-1/2) |   |

**AUTHORIZATION REQUIRED**