

LOC I- UIN 110.1	APP CRS 038°	Rwy Idg TDZE Apt Elev	7098 763 768
-----------------------------------	------------------------	-----------------------------	---

ILS or LOC RWY 4

QUINCY RGNL-BALDWIN FLD (UIN)

ADF required.
RADAR required for procedure entry at RAYOK.

▼



NA

DME from UIN TACAN. DME use requires simultaneous reception of I-UIN and UIN TACAN. When local altimeter setting not received, use Pittsfield altimeter setting and increase S-ILS 04 DA to 1033 feet; increase all MDAs 80 feet and S-LOC 04 visibility Cat C/D ¾ SM. For inop ALS when local altimeter not received, increase S-ILS 4 all Cats visibility to ¾ SM and S-LOC 4 Cat C and D visibility to 1 ¾ SM.

MALSR

MISSED APPROACH: Climb to 1800 then climbing right turn to 2300 direct QUINCY LOM and hold.

ASOS 121.425	KANSAS CITY CENTER 126.225 317.775	UNICOM 123.0 (CTAF) 1
------------------------	--	---------------------------------

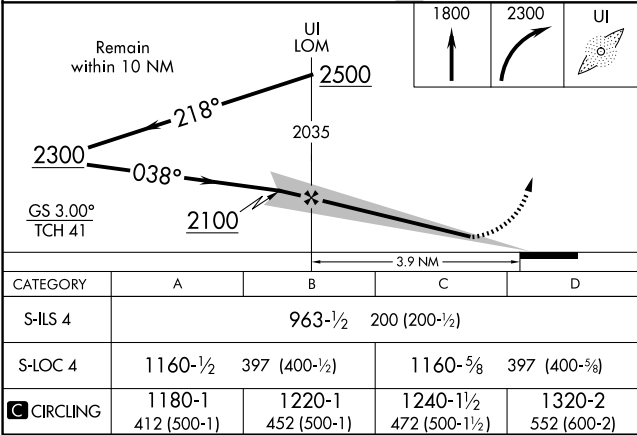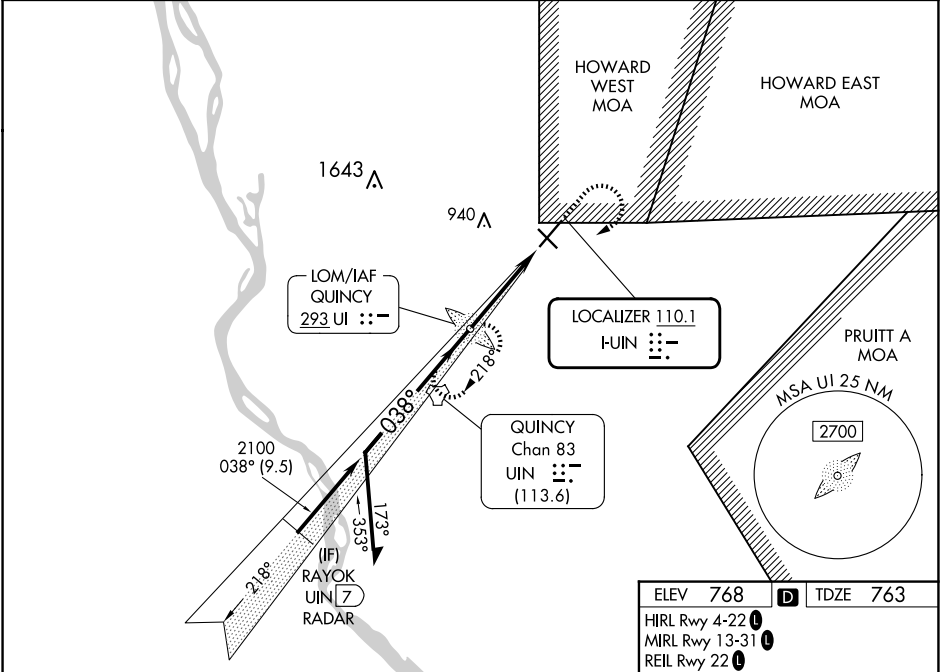

ELEV 768	TDZE 763
HIRL Rwy 4-22	
MIRL Rwy 13-31	
REIL Rwy 22	

1800	2300	UI

2500	2035	2100	2300

3.9 NM	7098 X 150	5392 X 150

038°	820	13	22

FAF to MAP 3.9 NM
Knots 60 90 120 150 180
Min:Sec 3:54 2:36 1:57 1:34 1:18