

LOC/DME I-OYC
109.5
Chan 32

APP CRS
355°

Rwy Ldg
TDZE
Apt Elev
6080
40
46


ILS or LOC RWY 36
CORPUS CHRISTI INTL (CRP)

DME required.
▼ For inop ALS, increase S-ILS 36 Cat E visibility to RVR 4000 and S-LOC 36 Cat C/D/E visibility to RVR 4500.

MALSR

MISSED APPROACH: Climb to 700 then climbing left turn to 2000 on heading 338° and CRP VORTAC R-287 to ATHIS INT/CRP 23.3 DME and hold.

ATIS 126.8	CORPUS APP CON 120.9 348.725	CORPUS TOWER 119.4 257.8	GND CON 121.9 269.15	CLNC DEL 118.55
----------------------	--	------------------------------------	--------------------------------	---------------------------

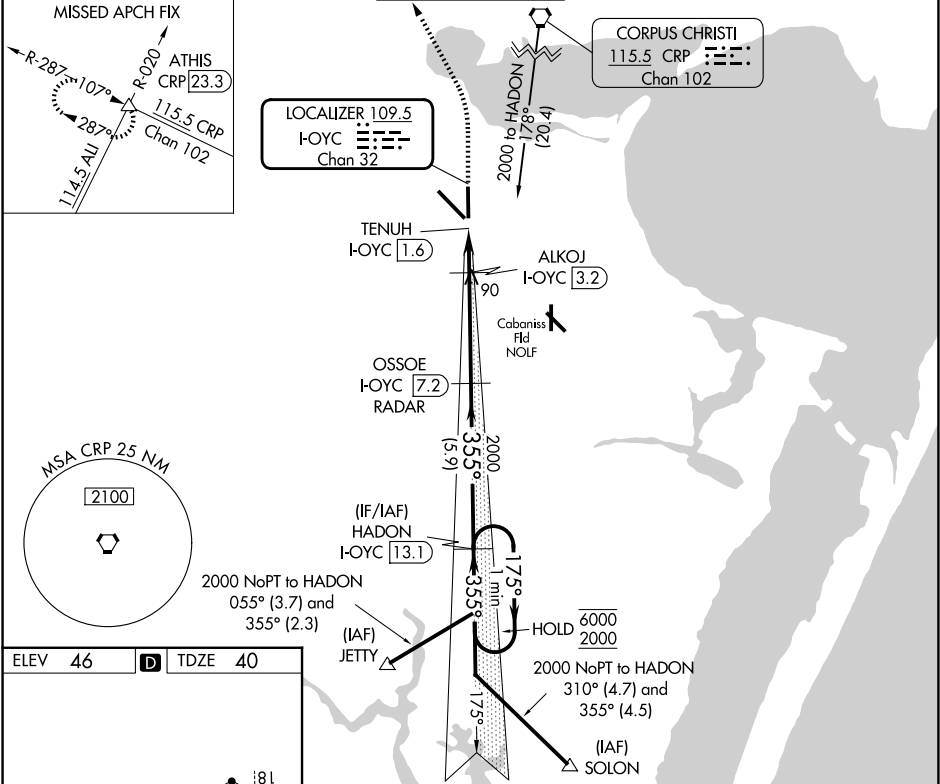

700	2000	CRP R-287	ATHIS	ILS unusable inside DA. LOC unusable within 1.6 DME.	
hdg 338°				OSSOE I-OYC 7.2 RADAR	HADON I-OYC 13.1
				One Minute Holding Pattern	
				2000	2000
				355°	175°
				720	6000
				2000	2000
				GS 3.00°	TCH 53
				0.4	1.6 NM
				4 NM	5.9 NM
CATEGORY	A	B	C	D	E
S-ILS 36		240/24	200 (200-1/2)		
S-LOC 36		340/24	300 (300-1/2)		
CIRCLING	500-1 454 (500-1)	780-1 734 (800-1)	820-2 1/4 774 (800-2 1/4)	820-2 1/2 774 (800-2 1/2)	820-2 3/4 774 (800-2 3/4)