

24193

LOC I-OCF <u>111.5</u>	APP CRS 004°	Rwy Idg 6347 TDZE 80 Apt Elev 90
----------------------------------	------------------------	---

ILS or LOC RWY 36
OCALA INTL-JIM TAYLOR FLD (OCF)

DME required.




DME from OCF VORTAC. DME use requires simultaneous reception of I-OCF and OCF DME. Inop table does not apply to S-ILS 36 all Cats. For inop ALS, increase S-LOC 36 Cats A and B visibility to 1 SM.

MALSR



MISSED APPROACH: Climb to 2000 on OCF VORTAC R-355 to JODON/OCF VORTAC 16 DME and hold.

ATIS 128.125	JACKSONVILLE APP CON 118.6 251.15	OCALA TOWER ★ 119.25 (CTAF) ①	GND CON 121.4
------------------------	---	---	-------------------------

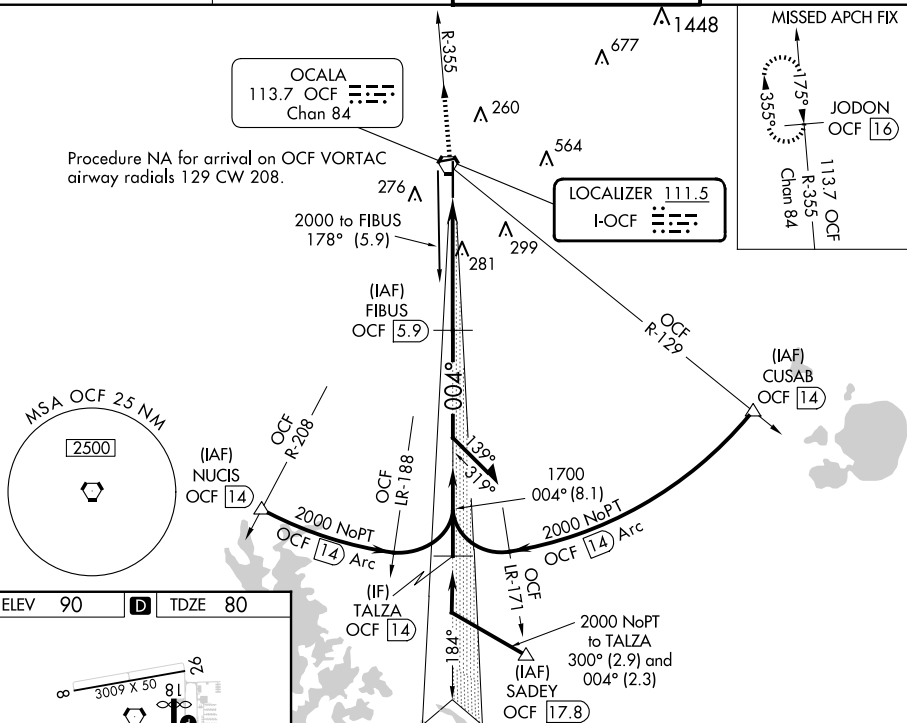

2000
↑
OCF R-355

JODON
OCF 16

FIBUS
OCF 5.9

1700

184°

2000

004°

1700

GS 3.00°
TCH 50

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 45).

1.3 NM

3.6 NM

Remain within 10 NM

CATEGORY	A	B	C	D
S-ILS 36	280- ³ / ₄ 200 (200- ³ / ₄)			
S-LOC 36	540- ³ / ₄	460 (500- ³ / ₄)	540- ⁷ / ₈	460 (500- ⁷ / ₈)
CIRCLING	600-1	510 (600-1)	760- ¹ / ₄ 670 (700- ¹ / ₄)	920- ² / ₄ 830 (900- ² / ₄)

OCALA, FLORIDA

Amdt 2 23FEB23

OCALA INTL-JIM TAYLOR FLD (OCF)

ILS or LOC RWY 36

29°10'N-82°13'W

SE-3, 04 SEP 2025 to 02 OCT 2025