
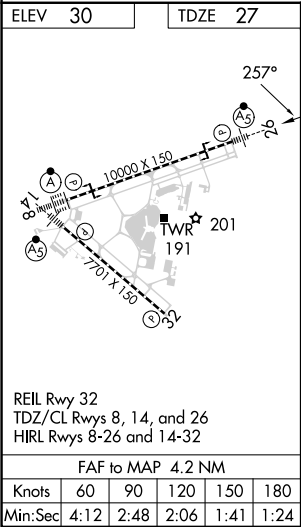


LOC I-PEK	APP CRS	Rwy ldg	10000
110.3	257°	TDZE	27
		Apt Elev	30

ILS Y or LOC Y RWY 26

JACKSONVILLE INTL (JAX)

ADF required. RADAR required for procedure entry.				MALSR 	MISSED APPROACH: Climb to 3000 direct DINNS LOM and hold, continue climb-in-hold to 3000.	
 For inop ALS, ZETRI Fix Minimums: increase S-LOC 26 Cats C/D visibility to RVR 5500.						
D-ATIS 125.85	JACKSONVILLE APP CON 119.0 269.9	JACKSONVILLE TOWER 118.3 317.7	GND CON 121.9 348.6	CLNC DEL 119.5 290.275	CPDLC	

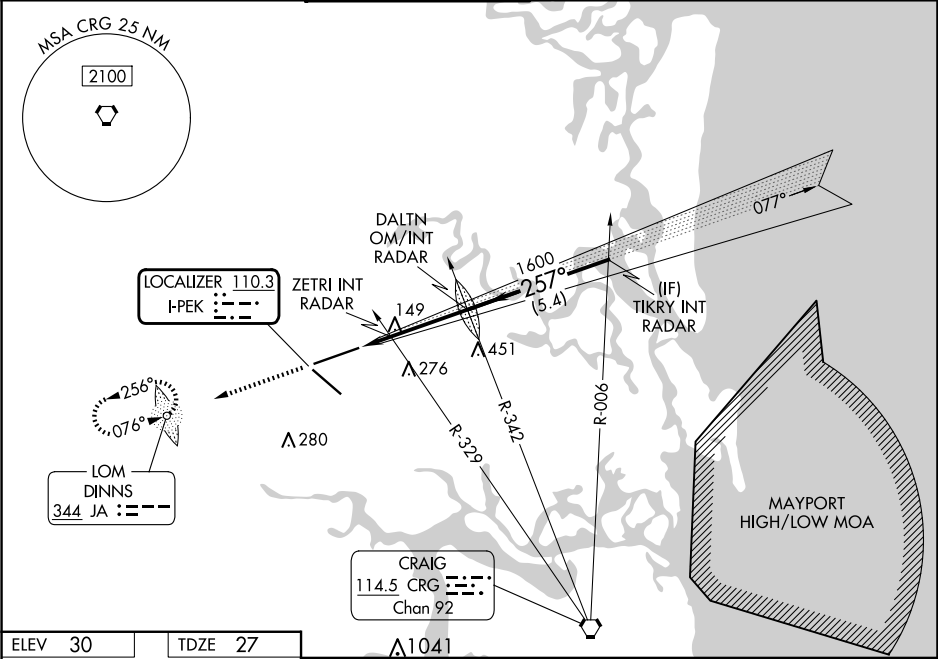

3000 DINNS VGSi and ILS glidepath not coincident (VGSi Angle 3.00/TCH 70).				
DALTN OM/INT RADAR TIKRY INT RADAR				
ZETRI INT RADAR 1402 257° 2000				
GS 3.00° TCH 55				
CATEGORY	A	B	C	D
S-ILS 26	227/18 200 (200-½)			
S-LOC 26	480/24	453 (500-½)	480/45	453 (500-¾)
CIRCLING	520-1	490 (500-1)	580-1½	580-2
			550 (600-1½)	550 (600-2)
ZETRI FIX MINIMUMS (DUAL VOR RECEIVERS REQUIRED)				
S-LOC 26	400/24	373 (400-½)	400/35	373 (400-¾)
CIRCLING	520-1	490 (500-1)	580-1½	580-2
			550 (600-1½)	550 (600-2)