

APP CRS	Rwy Idg	10000
077°	TDZE	29
	Apt Elev	29

RNAV (RNP) Y RWY 8
JACKSONVILLE INTL (JAX)

T For uncompensated Baro-VNAV systems, procedure NA below -5°C (23°F) or above 54°C (130°F). GPS required. For inop MALSR, increase RNP 0.11 all Cats visibility to 1 mile, increase RNP 0.30 all Cats visibility to 1 3/8 mile.

ALSF-2



MISSED APPROACH: Climb to 2000 on track 077° to YEJWO and hold.

D-ATIS
125.85


JACKSONVILLE APP CON
119.0 269.9

JACKSONVILLE TOWER
118.3 317.7

GND CON
121.9 348.6

CLNC DEL
119.5 290.275

CPDLC

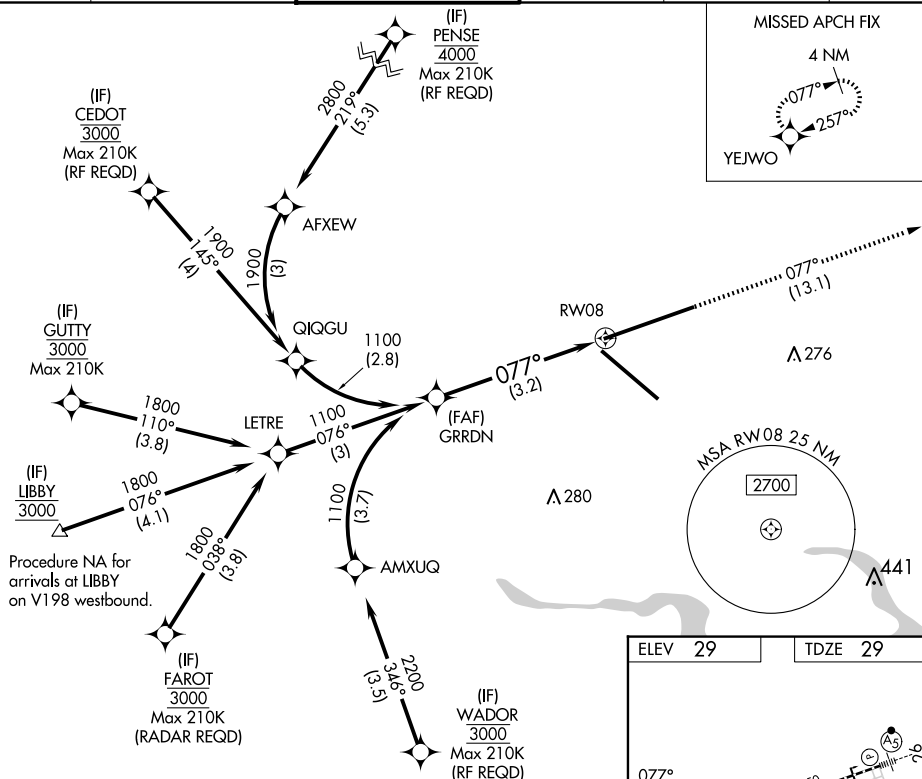

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 70).

2000	YEJWO
------	-------

| tr | 077° |

GRRDN
|
1100

1100
GP 3.00
TCH 51

See planview for multiple IF locations.

RW0:

3.2 nm

CATEGORY	A	B	C	D
RNP 0.11 DA		356/40	327 (400-¾)	
RNP 0.30 DA		426/45	397 (400-⅞)	

REIL Rwy 32
TDZ/CL Rwy 8, 14, and 26
HIRL Rwy 8-26 and 14-32

JACKSONVILLE, FLORIDA

Orig-B 30APR15

30°30'N-81°41'W

JACKSONVILLE INTL (JAX)

RNAV (RNP) Y RWY 8

SE-3, 04 SEP 2025 to 02 OCT 2025