
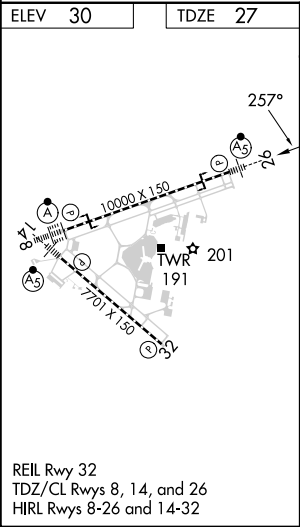



WAAS CH 97626 W26A	APP CRS 257°	Rwy Idg 10000 TDZE 27 Apt Elev 30
--	------------------------	--

RNAV (GPS) Z RWY 26

JACKSONVILLE INTL (JAX)

RNP APCH-GPS. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -5°C or above 54°C. For inoperative MALSR, increase LNAV/VNAV all Cats visibility to RVR 4500 and increase LNAV Cats C/D visibility to RVR 5500.		MALSR 	MISSED APPROACH: Climb to 2000 direct UDAQI and hold.		
D-ATIS 125.85	JACKSONVILLE APP CON 119.0 269.9	JACKSONVILLE TOWER 118.3 317.7	GND CON 121.9 348.6	CLNC DEL 119.5 290.275	CPDLC

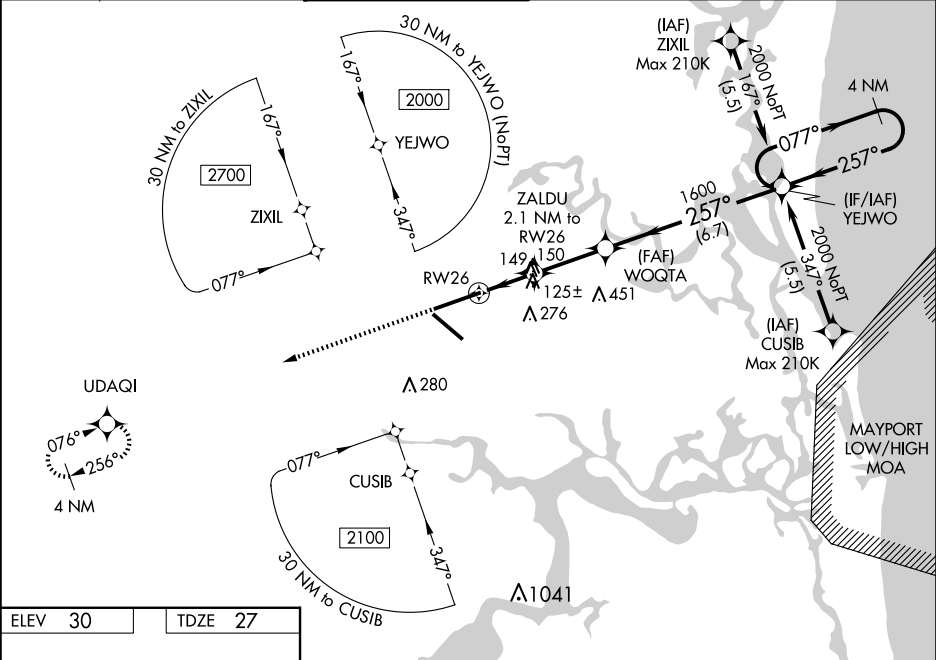

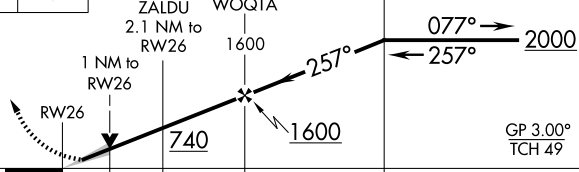2000 ↑	UDAQI 	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).				YEJWO 4 NM Holding Pattern	
							
CATEGORY		A		B	C	D	
LPV DA	227/18 200 (200-½)						
LNAV/ VNAV	DA	300/24 273 (300-½)					
LNAV MDA	400/24 373 (400-½)				400/35 373 (400-¾)		
CIRCLING	520-1 490 (500-1)				580-1½ 550 (600-1½)		640-2 610 (700-2)