

TIFFIN, OHIO

AL-5645 (FAA)

23054

WAAS CH 90528 W24A	APP CRS 242°	Rwy Idg 4000 TDZE 785 Apt Elev 786
--	------------------------	---

RNAV (GPS) RWY 24
SENECA COUNTY(16G)

RNP APCH.



NA Circling to Rwy 24 NA at night. Baro-VNAV NA when using Findlay altimeter setting. Rwy 24 helicopter visibility reduction below $\frac{3}{4}$ SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. When local altimeter setting not received, use Findlay altimeter setting and increase all DA/MDA 60 feet, and increase LPV, LNAV/VNAV all Cnts visibility $\frac{1}{8}$ SM, increase LNAV and Circling Cat C visibility $\frac{1}{4}$ mile.

MISSED APPROACH.
Climb to 2400 direct
MAZKY and hold.



AWOS-3 127,175	FDY ASOS 132.85	TOLEDO APP CON 120.8 317.55	UNICOM 123.0 (CTAF) 0
--------------------------	---------------------------	---------------------------------------	---------------------------------

MISSED APCH FIX

MAZKY

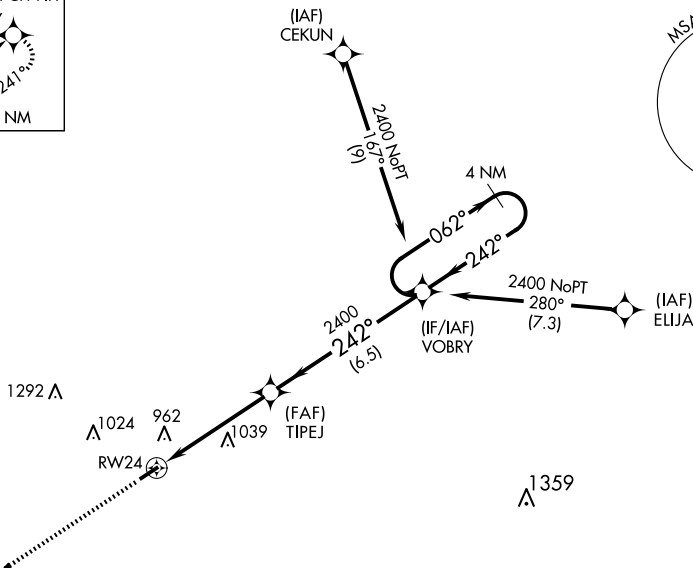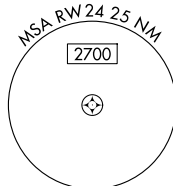

ELEV	786		TDZE	785
------	-----	--	------	-----

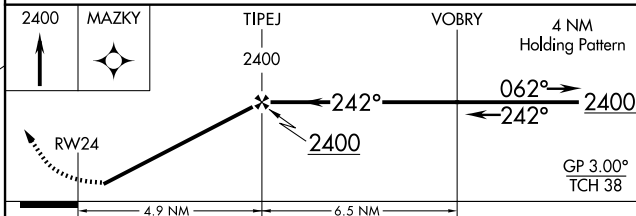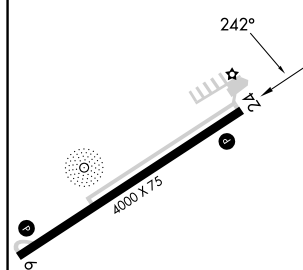

CATEGORY	A	B	C	D
LPV DA	1058-1	273 (300-1)		NA
RNAV/ VNAV DA	1063-1	278 (300-1)		NA
RNAV MDA	1280-1	495 (500-1)	1280-1 ³ / ₈ 495 (500-1 ³ / ₈)	NA
CIRCLING	1280-1	494 (500-1)	1340-1 ¹ / ₂ 554 (600-1 ¹ / ₂)	NA

TIFFIN, OHIO

Amdt 1D 27JAN22

41°06'N-83°13'W

SENECA COUNTY(16G)

RNAV (GPS) RWY 24

EC-2, 04 SEP 2025 to 02 OCT 2025