

APP CRS
226°

Rwy Idg
4797

TDZE
1023

Apt Elev
1029

RNAV (GPS) RWY 22

HARDIN COUNTY (I95)


▼

NA

Rwy 22 helicopter visibility reduction below 1 SM NA. Procedure NA at night. Circling NA for Cat D NW of Rwy 04-22. When local altimeter setting not received, use Lima altimeter setting and increase all MDAs 60 feet and LNAV visibility Cat C ⅓ SM and Circling visibility Cat C ½ SM.

MISSED APPROACH: Climb to 3000 direct YEDUK and hold.

AWOS-3 126.4	AOH ASOS 128.725	COLUMBUS APP CON 134.45 323.15	UNICOM 122.8 (CTAF) 0★
-----------------	---------------------	-----------------------------------	---------------------------

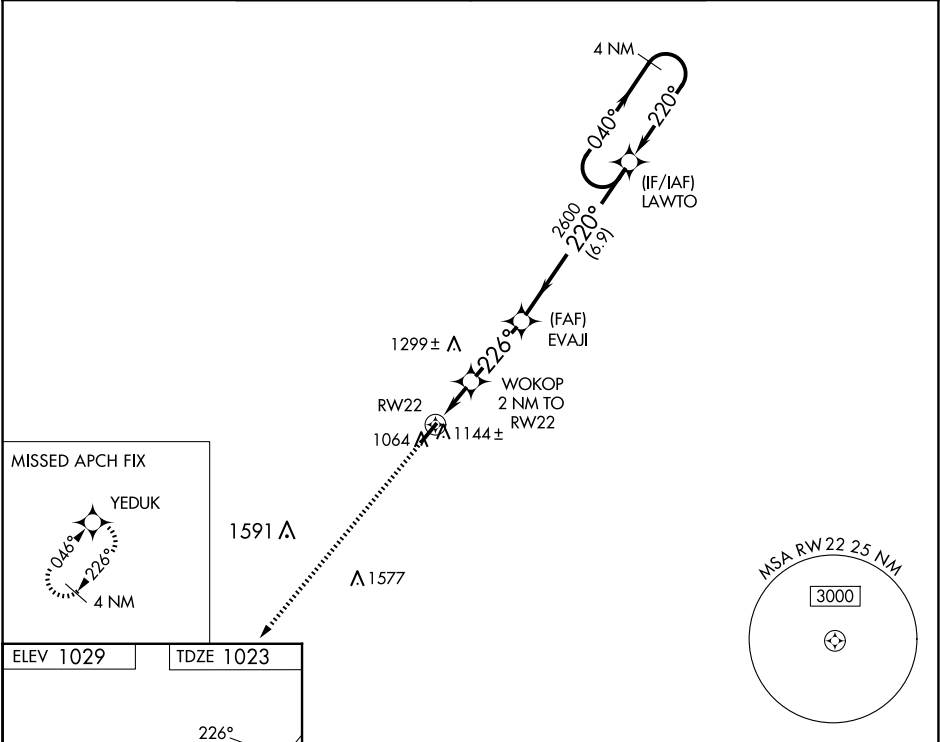

ELEV 1029

TDZE 1023

3000

YEDUK

Visual Segment - Obstacles.

4 NM Holding Pattern

226°

0.5% UP

4797 X 75

WOKOP 2 NM TO RW22

EVAJI

LAWTO

040°

220°

3000

2600

1680

2 NM

2.8 NM

6.9 NM

CATEGORY	A	B	C	D
LNAV MDA	1460-1	437 (500-1)	1460-1¼ 437 (500-1¼)	1460-1½ 437 (500-1½)
CIRCLING	1580-1 551 (600-1)	1620-1 591 (600-1)	1620-1½ 591 (600-1½)	1620-2 591 (600-2)

EC-2, 04 SEP 2025 to 02 OCT 2025

EC-2, 04 SEP 2025 to 02 OCT 2025