

JOHNSTOWN, NEW YORK

AL-6987 (FAA)

22251

WAAS CH 53619 W28A	APP CRS 284°	Rwy Idg 4000 TDZE 881 Apt Elev 881
--	------------------------	---

RNAV (GPS) RWY 28

RNP APCH - GPS.	
-----------------	--




Rwy 28 helicopter visibility reduction below $\frac{3}{4}$ SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C.

MISSED APPROACH: Climb to 5000 direct ASQEV and hold, continue climb-in-hold to 5000.

AWOS-3
119.225

ALBANY APP CON
118.05

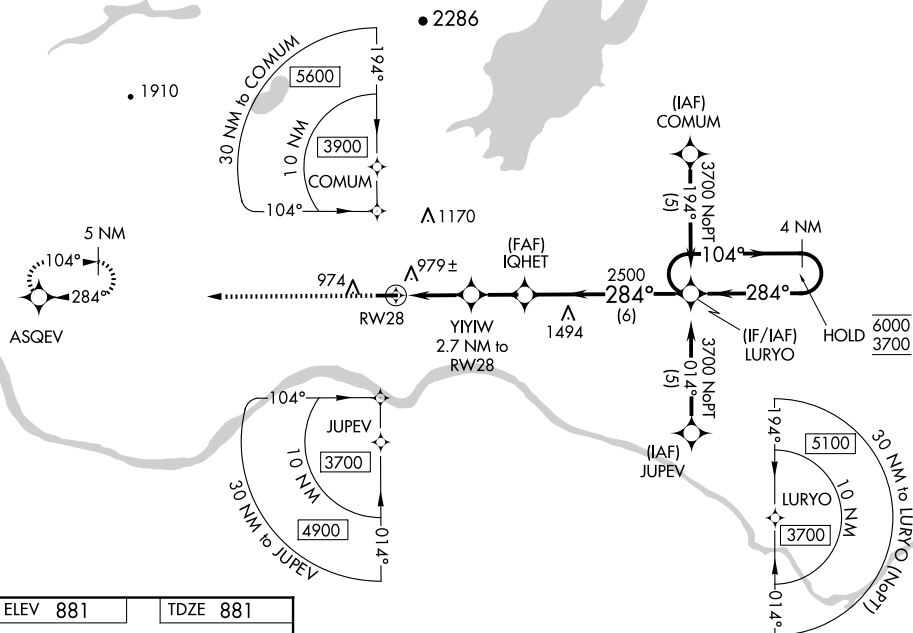UNICOM
122.7 (CTAF) **L**

NE-2, 04 SEP 2025 to 02 OCT 2025

ELEV 881		TDZE 881
----------	--	----------



5000	ASQEV
------	-------

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 40).

dent

LURYO

4 NM
Holding Pattern

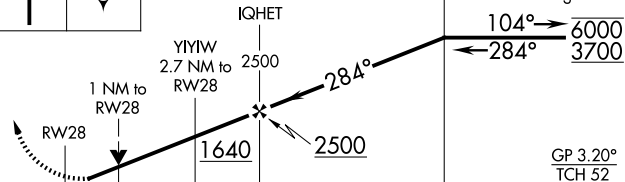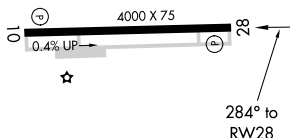

CATEGORY		A	B	C	D
LPV	DA	1131- $\frac{3}{4}$	250 (300- $\frac{3}{4}$)		NA
RNAV/ VNAV	DA	1141- $\frac{3}{4}$	260 (300- $\frac{3}{4}$)		NA
	MDA	1240-1	359 (400-1)		NA
 CIRCLING		1280-1 399 (400-1)	1340-1 459 (500-1)		NA

MIRL Rwy 10-28 **L**
REIL Rwy 10 and 28 **L**

JOHNSTOWN, NEW YORK

Amdt 1 08SEP22

43°00'N-74°20'W

FULTON COUNTY (NY0)

RNAV (GPS) RWY 28