

MARTIN, SOUTH DAKOTA

AL-9035 (FAA)

19199

WAAS CH 77540 W32A	APP CRS 320°	Rwy Idg 3699 TDZE 3294 Apt Elev 3295
--	------------------------	---

RNAV (GPS) RWY 32
MARTIN MUNI (9V6)


RNP APCH.




A NA

MISSED APPROACH: Climb to 3800 then climbing right turn to 6000 direct USETY and hold.

AWOS-2 123.0	DENVER CENTER 127.95 338.2	CTAF 122.90
------------------------	--------------------------------------	-----------------------

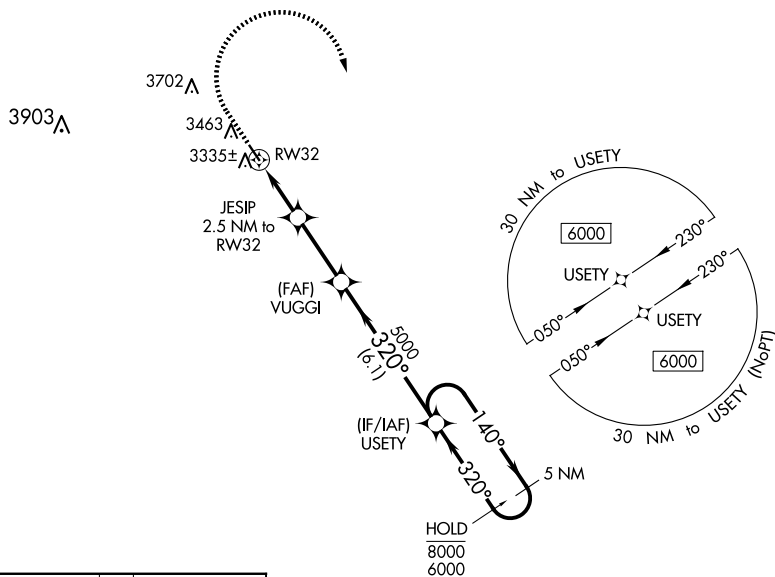

ELEV 3295		TDZE 3294
-----------	--	-----------

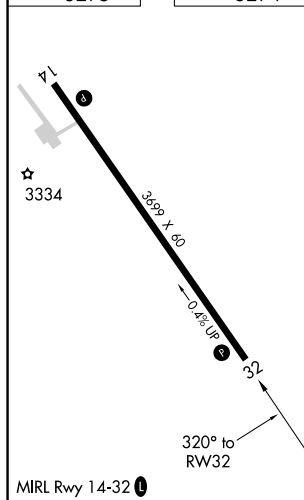

3800
6000
USETY

VGS1 and RNAV glidepath not coincident
(VGS1 Angle 3.00°/TCH 28).

5 NM Holding Pattern

*LNAV only

JESIP
2.5 NM to RW32

VUGGI
5000

140° → 8000
← 320° 6000

* 0.9 NM to RW32

RW32

4100*

GP 3.00° TCH 40

0.9 1.6 NM 2.8 NM 6.1 NM

CATEGORY	A	B	C	D
LPV DA	3544-1	250 (300-1)		NA
LNAV/VNAV	3544-1	250 (300-1)		NA
LNAV MDA	3600-1	306 (400-1)		NA
C CIRCLING	3780-1 485 (500-1)	3820-1 525 (600-1)	4060-2½ 765 (800-2½)	NA

MARTIN, SOUTH DAKOTA

Amdt 1A 18JUL19

MARTIN MUNI (9V6)

43°10'N-101°43'W

RNAV (GPS) RWY 32

NC-1, 04 SEP 2025 to 02 OCT 2025

NC-1, 04 SEP 2025 to 02 OCT 2025