


GOLDSBORO, NORTH CAROLINA

TACAN Y RWY 8

TACAN GSB Chan 112	APCH CRS 081°	Rwy Idg 11,760 TDZE 73 Arpt Elev 109	[USAF]	SEYMOUR JOHNSON AFB (KGSB)
* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles. ** Circling N of Rwy 8-26 not authorized.			ALSF-1 (A1)	MISSED APPROACH: Climb to 2300 via GSB R-081 to ZILOB and hold.
ATIS ★ 317.625	APP CON 123.7 290.9 (258°-110°) 119.7 273.6 (111°-257°)	TOWER ★ 126.25 370.875	GND CON 132.45 275.8	CLNC DEL 128.025 270.8

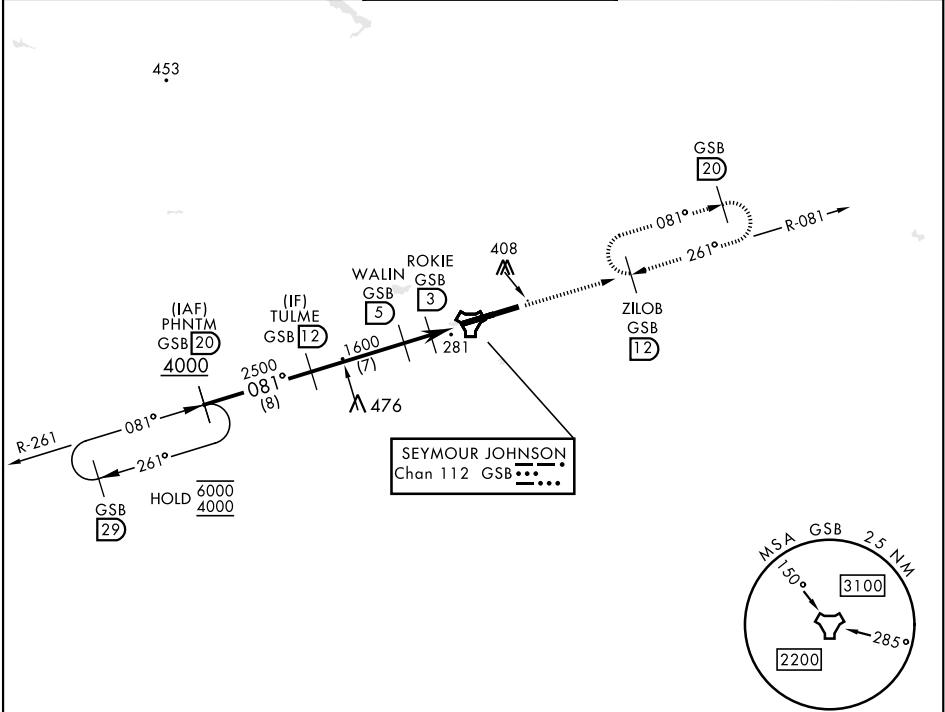

EMERG SAFE ALT 100 NM 3700

TULME 1200 2500 081°		WALIN 500 1600 081°		ROKIE 300 960 081°		TACAN 1.7 ZESIX 0.9 2300 GSB R-081 ZILOB R-081 1200	
† 3.01° TCH 55		2 NM		2.1 NM		0.3 NM	
CATEGORY	A	B	C	D	E		
S-8 *	540/24	467 (500-1/2)	540/50	467 (500-1)			
CIRCLING **	580-1 471 (500-1)	600-1 491 (500-1)	680-1 1/2 571 (600-1 1/2)	740-2 631 (700-2)	740-2 1/4 631 (700-2 1/4)		

TACAN Y RWY 8

SE-2, 02 OCT 2025 to 30 OCT 2025

SE-2, 02 OCT 2025 to 30 OCT 2025