


VORTAC MSN	APP CRS	Rwy Ldg	5846
108.6	310°	TDZE	862
Chan 23		Apt Elev	887

VOR RWY 32

DANE COUNTY RGNL/TRUAX FLD (MSN)

When VGSI inop, Straight-In and Circling Rwy 32 procedures NA at night. Visibility reduction by helicopters NA.		MISSED APPROACH: Climb to 2600 then right turn direct MSN VORTAC and hold.		
ATIS 124.65 278.3	MADISON APP CON★ 135.45 343.7	MADISON TOWER ★ 119.3 (CTAF) 0 257.8	GND CON 121.9 348.6	UNICOM 122.95

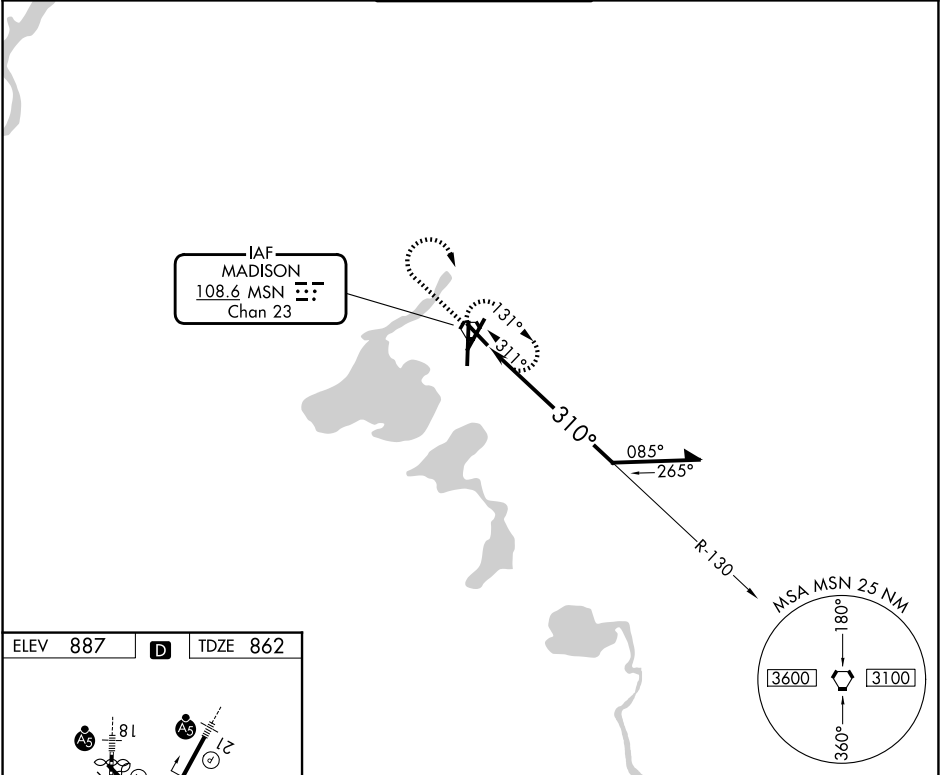

ELEV 887

D

TDZE 862

The diagram illustrates the approach procedure, showing the descent to 7000 feet and the holding pattern. It includes a scale bar and a north arrow.

2600

MSN

MSN VORTAC

Remain within 10 NM

Procedure Turn: Descend to 7000 in MSN VORTAC holding pattern prior to departing outbound for procedure turn.

CATEGORY	A	B	C	D
S-32	1560-1	698 (700-1)	1560-2	698 (700-2)
CIRCLING	1560-1	673 (700-1)	1560-2 673 (700-2)	1700-2¾ 813 (900-2¾)