

WAAS CH 82211 W25B	APP CRS 258°	Rwy Idg 7800 TDZE 1126 Apt Elev 1135
--	------------------------	---

RNAV (GPS) Y RWY 25L

PHOENIX SKY HARBOR INTL (PHX)

RNP APCH-GPS.

T Simultaneous approach authorized. LNAV procedure NA during simultaneous operations. Use of FD or AP required during simultaneous operations. For uncompensated Baro-VNAV systems, procedure NA below 2°C or above 54°C. For inop ALS, increase visibility LPV all Cats to 1 SM, LNAV/VNAV all Cats to 1½ SM and LNAV Cats C/D 1½ SM.



MALS®




MISSED APPROACH: Climb to 1900 then climbing left turn to 5000 direct CHOCK and on track 145° to BRAAK and hold.

D-ATIS 127.575	PHOENIX APP CON 128.65 353.9	PHOENIX TOWER 118.7 278.8 (Rwy 8-26) 120.9 254.3 (Rwy 7L-25R, 7R-25L)	GND CON 119.75 269.2 (N) 132.55 269.2 (S)	CLNC DEL 118.1 269.2	CPDLC
--------------------------	--	---	---	--------------------------------	-------

MISSED APCH FIX

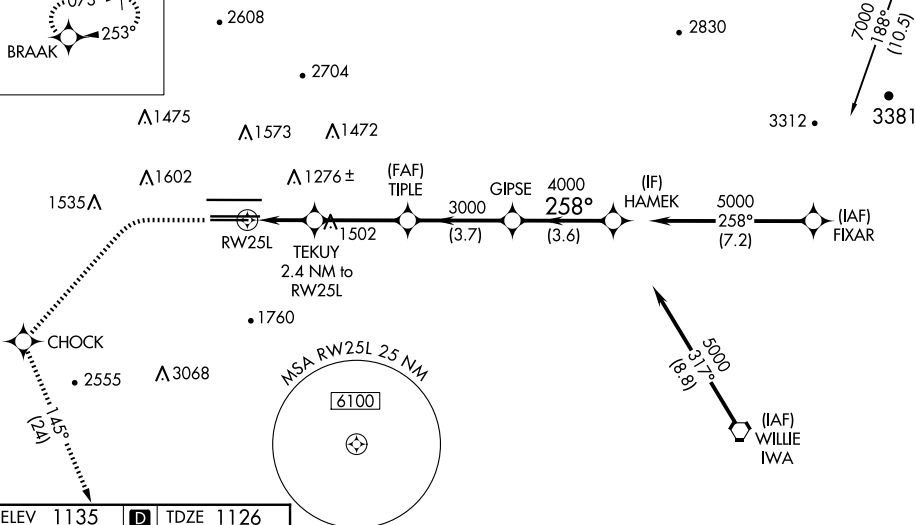

ELEV 1135	D	TDZE 1126
-----------	----------	-----------

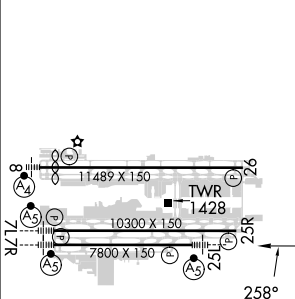

VGS and RNAV glidepath not coincident (VGS Angle 3.00/TCH 66).

1900 5000 CHOCK tr 145° BRAAK

TEKUY 2.4 NM to RW25L

1.7 NM to RW25L

RW25L

1.7 NM

0.7 NM

3.3 NM

3.7 NM

3.6 NM

TIPLE 3000

GIPSE

HAMEK 5000

258°

4000

3000

1940

GP 3.00° TCH 49

CATEGORY	A	B	C	D
LPV DA	1449-1/2 323 (400-1/2)			
RNAV/ VNAV DA	1589-1 463 (500-1)			1674-1 1/8 548 (600-1 1/8)
RNAV MDA	1740-1/2 614 (700-1/2)		1740-1 3/8 614 (700-1 1/8)	
CIRCLING	1740-1 605 (700-1)		2040-2 3/4 905 (1000-2 3/4) 2340-3 1205 (1300-3)	