

SUMTER, SOUTH CAROLINA

TACAN Y RWY 4L

SUMTER, SOUTH CAROLINA		4L	4R	
TACAN	SSC	Rwy Idg	10,014	8014
Chan	38	TDZE	240	236
		Arpt Elev	241	241

[USAF]

SHAW AFB (KSSC)

RADAR required when R-6002 active.


T * When ALS inop, increase CAT AB RVR to 55 and vis to 1 mile, CAT CDE vis to 1½ miles.

ALSF-1




MISSED APPROACH: Climbing to 2000, intercept SSC TACAN R-042 to GABLE and hold.

ATIS★ 132.125 270.1	APP CON★ 125.4 318.1	TOWER★ 126.65 254.25	GND CON 126.1 275.8
------------------------	-------------------------	-------------------------	------------------------

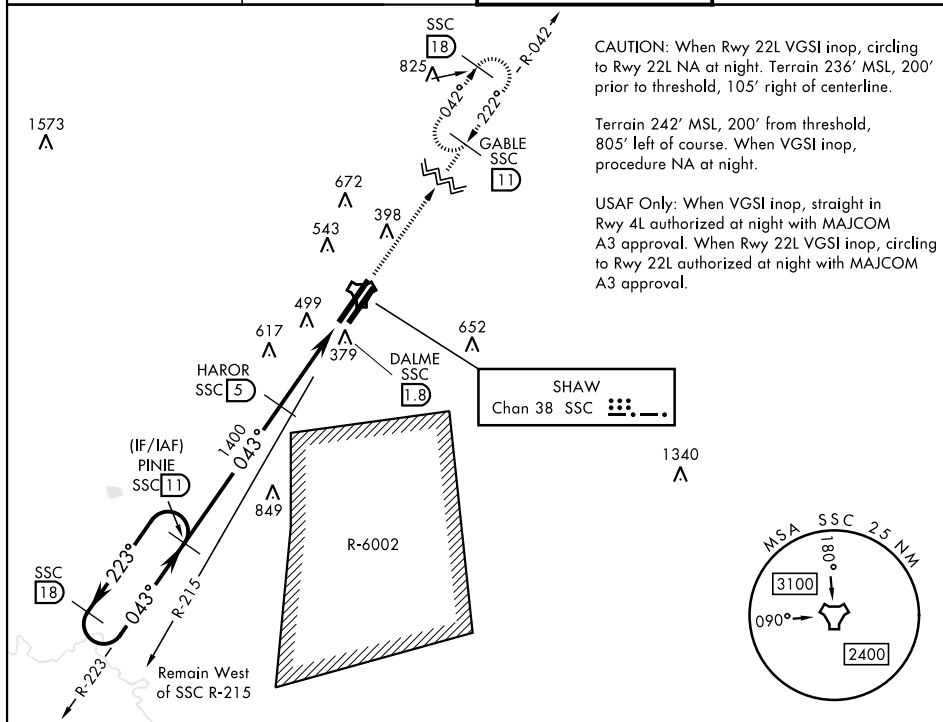

EMERG SAFE ALT 100 NM 3800

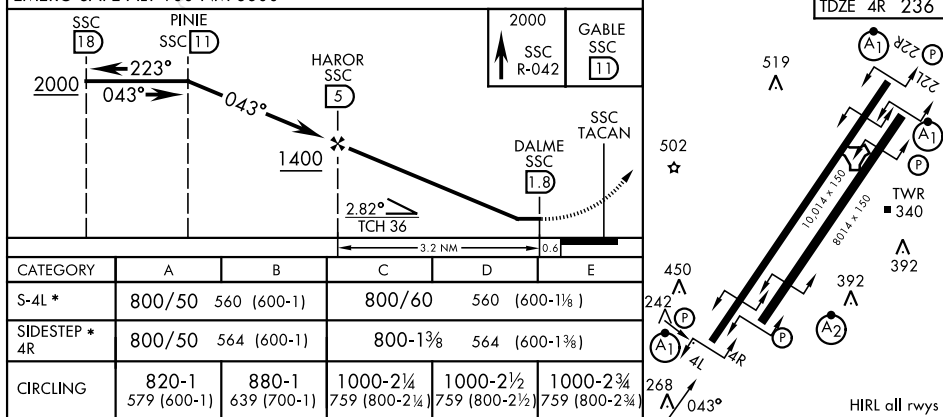

SUMTER, SOUTH CAROLINA
Amdt 1 07NOV19

33° 58' N-80° 28' W

SHAW AFB (KSSC)

TACAN Y RWY 4L

SE-2, 02 OCT 2025 to 30 OCT 2025

SE-2, 02 OCT 2025 to 30 OCT 2025