


WAAS CH 50244 W31A	APP CRS 300°	Rwy Ldg TDZE Apt Elev 8500 429 476
--	------------------------	--

RNAV (GPS) Z RWY 31L

PALM SPRINGS INTL (PSP)

RNP APCH-GPS.		MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold. *Missed approach requires minimum climb of 355 feet per NM to 2100.			
⚠ Circling NA southwest of Rwy 13R-31L.					
ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER * 119.7 (CTAF) 377.05	GND CON 121.9	CLNC DEL 128.35	UNICOM 122.95

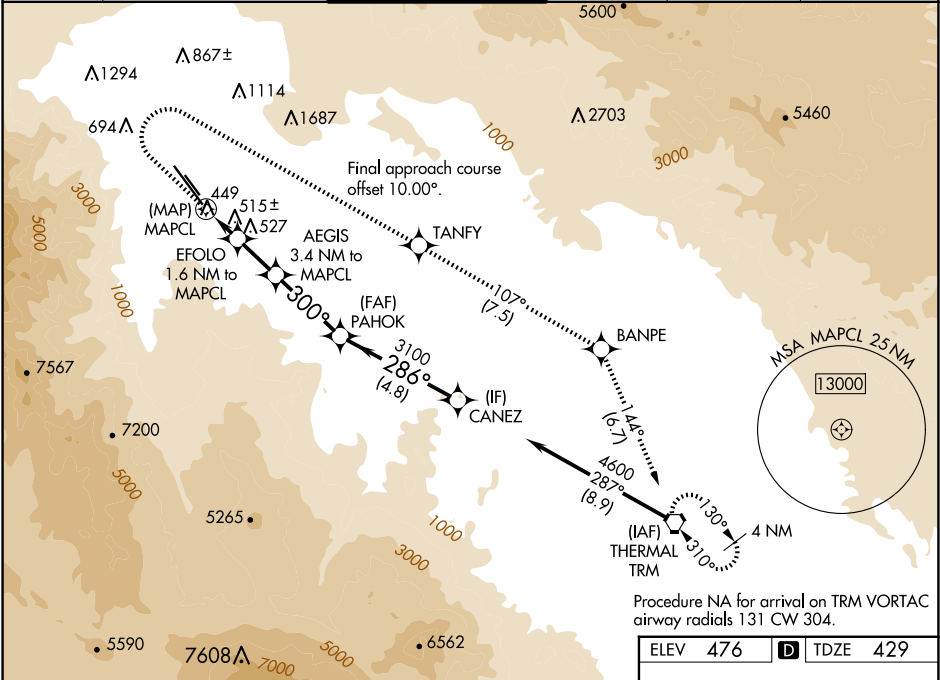

ELEV 476	TDZE 429
----------	----------

900 ↑	4000 ↗	TANFY ✧	tr 107°	BANPE ✧	tr 144°	TRM ◡		
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 55).							PAHOK	CANEZ
							4600	
EFOLO 1.6 NM to MAPCL							AEGIS 3.4 NM to MAPCL	3100
MAPCL							300°	286°
1220							1920	
0.5							3.2 NM	4.8 NM
1.6 NM								
1.9 NM								
3.2 NM								
4.8 NM								
CATEGORY		A		B		C		D
LP	MDA	700-1 271 (300-1)		780-1 351 (400-1)		1320-2½		891 (900-2½)
RNAV MDA*		780-1 351 (400-1)						
RNAV MDA		920-1 491 (500-1)		1180-1¼ 751 (800-1¼)		1440-3		1011 (1000-3)
CIRCLING		920-1 444 (500-1)		1180-1¼ 704 (800-1¼)		1440-3		1760-3
						964 (1000-3)		1284 (1300-3)

