


LOC/DME I-TUC 111.7 Chan 54	APP CRS 344°	Rwy ldg TDZE Apt Elev 9426 387 432
---	------------------------	--


ILS RWY 34C (SA CAT I & II)
SEATTLE-TACOMA INTL (SEA)

DME or RADAR required. From SONDR: RNAV 1-GPS required.	MALSR 	MISSED APPROACH: Climb on heading 345° and outbound on SEA VORTAC R-341 to cross COYLA/SEA 4.7 DME/RADAR at or above 3000 then climb to 5000 on SEA VORTAC R-341 to MGNUM/SEA 12.7 DME/RADAR and hold, continue climb-in-hold to 5000.
Simultaneous approach authorized with Rwy 34L. SA CAT I: Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH. SA CAT II: Reduced lighting: Requires specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.		

D-ATIS 118.0	SEATTLE APP CON 133.65 273.45	SEATTLE TOWER 119.9 239.3 (Rwys 16L, 16C, 34C, 34R) 120.95 239.3 (Rwys 16R, 34L)	GND CON 121.7	CLNC DEL 128.0	CPDLC
------------------------	---	--	-------------------------	--------------------------	-------

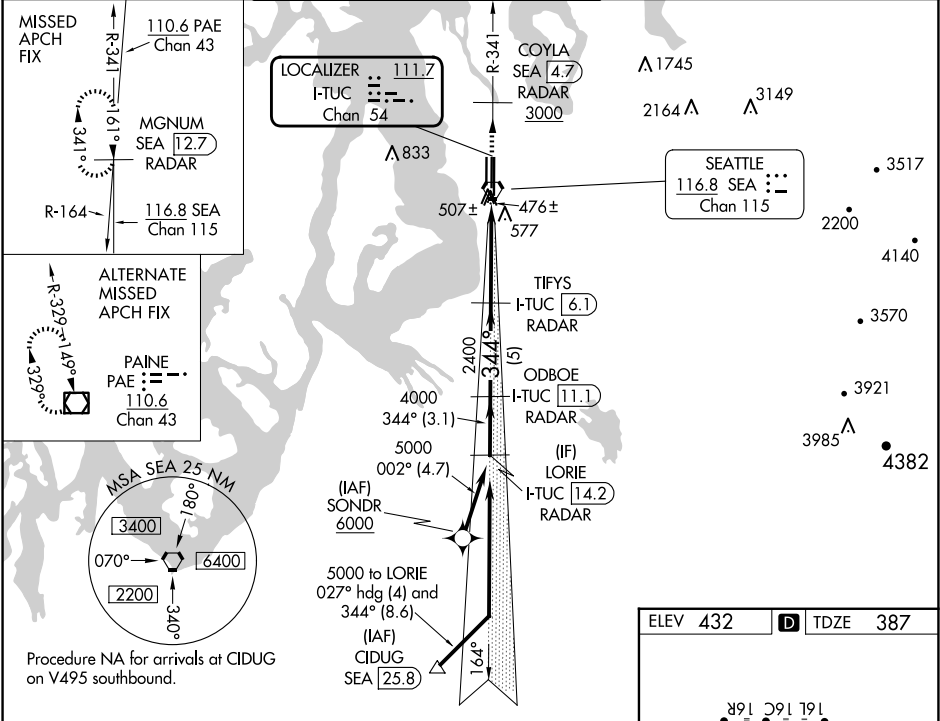

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 73).			
LORIE I-TUC [14.2] RADAR	ODBOE I-TUC [11.1] RADAR	TIFYS I-TUC [6.1] RADAR	5000 SEA R-341
5000	344°	2400	344°
GS 3.00° TCH 56	3.1 NM	5 NM	6.2 NM
CATEGORY	A	B	C
S-ILS 34C	SA CAT I	RA 231/14	150 DA 537
S-ILS 34C	SA CAT II	RA 112/12	100 DA 487
SA CATEGORY I & II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED			

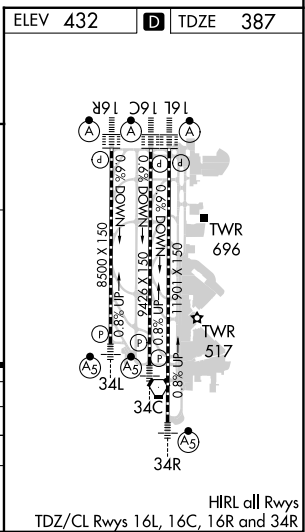

ILS RWY 34C (SA CAT I & II)

NW-1, 02 OCT 2025 to 30 OCT 2025

NW-1, 02 OCT 2025 to 30 OCT 2025