

RNAV (GPS) RWY 18

CAMPBELL AAF (FORT CAMPBELL) (KHOP)

MISSED APPROACH: Climbing left turn to 3000 direct SHRMN and hold.

T * Circling not authorized SE of Rwy 5-23.



ASR/
PAR

704

GSI and RNAV glidepath
not coincident
(GSI Angle 3.00/TCH 50).

ELEV	571	TDZE	562
------	-----	------	-----

180°	A_3
-------------	-------

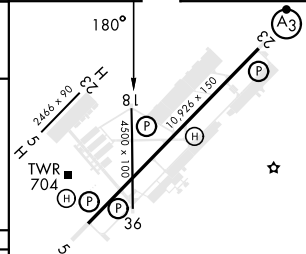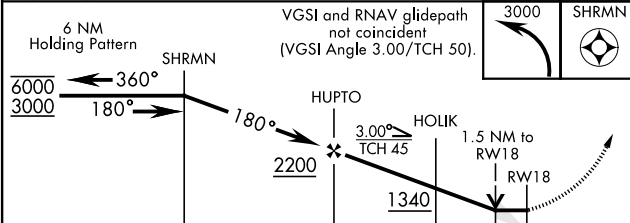

CATEGORY	A	B	C	D
INAV MDA	1080-1	518 (600-1)	1080-1 $\frac{3}{8}$ 518 (600-1 $\frac{3}{8}$)	NA
CIRCLING*	1080-1	509 (600-1)	1080-1 $\frac{1}{2}$ 509 (600-1 $\frac{1}{2}$)	NA

HIRL all rwys

CAMPBELL AAF (FORT CAMPBELL) (KHOP)

Amdt 2 15JUN23

RNAV (GPS) RWY 18

SE-1, 02 OCT 2025 to 30 OCT 2025