


APP CRS	Rwy Ldg	7614
306°	TDZE	57
	Apt Elev	62

RNAV (RNP) Z RWY 30L


NORMAN Y MINETA SAN JOSE INTL (SJC)

RNP AR APCH. ▼ For uncompensated Baro-VNAV systems, procedure NA below 1°C or above 54°C. For inop ALS, increase RNP 0.10 all Cats visibility to RVR 5500 and increase RNP 0.30 all Cats visibility to 1½ SM.	MALSR AS MISSED APPROACH: Climb to 2000 on track 306° to ARTAQ and hold.
--	--

D-ATIS 126.95	NORCAL APP CON 120.1 290.25	SAN JOSE TOWER★ 124.0 (CTAF) 0 257.6	GND CON 121.7	UNICOM 122.95
------------------	--------------------------------	---	------------------	------------------

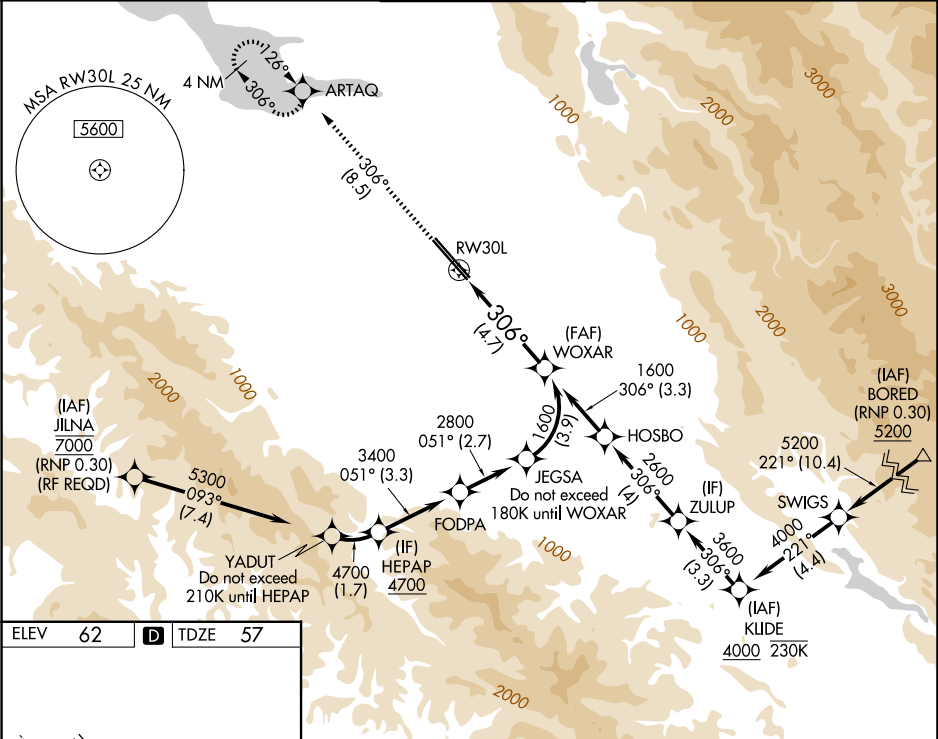

ELEV	62	D	TDZE	57
------	----	---	------	----

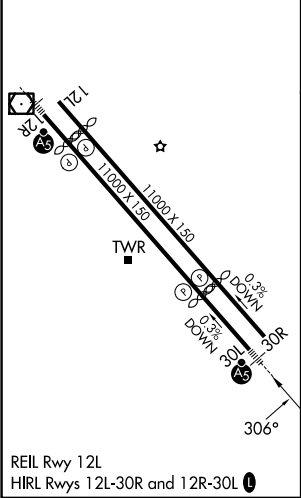

2000

↑

tr 306°

ARTAQ

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 70).

WOXAR

1600

See planview for multiple IF locations.

RW30L

306°

4.7 NM

GP 3.00°

TCH 54

1600

CATEGORY	A	B	C	D
RNP 0.10 DA		430/35	373 (400-½%)	
RNP 0.20 DA		464/40	407 (500-¾%)	
RNP 0.30 DA		541/50	484 (500-1)	

AUTHORIZATION REQUIRED