



MARYSVILLE, CALIFORNIA

25051

HI-TACAN Z RWY 33

TACAN BAB Chan 23	APCH CRS 317°	Rwy ldg TDZE Arprt Elev	12,001 105 113
----------------------	------------------	-------------------------------	----------------------

- (USAF)


BEALE AFB (KBAB)

V * When ALS inop, increase CAT CDE vis to 1 1/4 miles.
** Circling not authorized NE of Rwy 15-33.

ALSIF-1

MISSED APPROACH: Climb to 3600, intercept BAB TACAN R-326 to HAPAK and hold.

ATIS★ 124.55 273.5	NORCAL APP CON 125.4 259.1	TOWER★ 119.4 284.75	GND CON 121.6 257.75
-----------------------	-------------------------------	------------------------	-------------------------

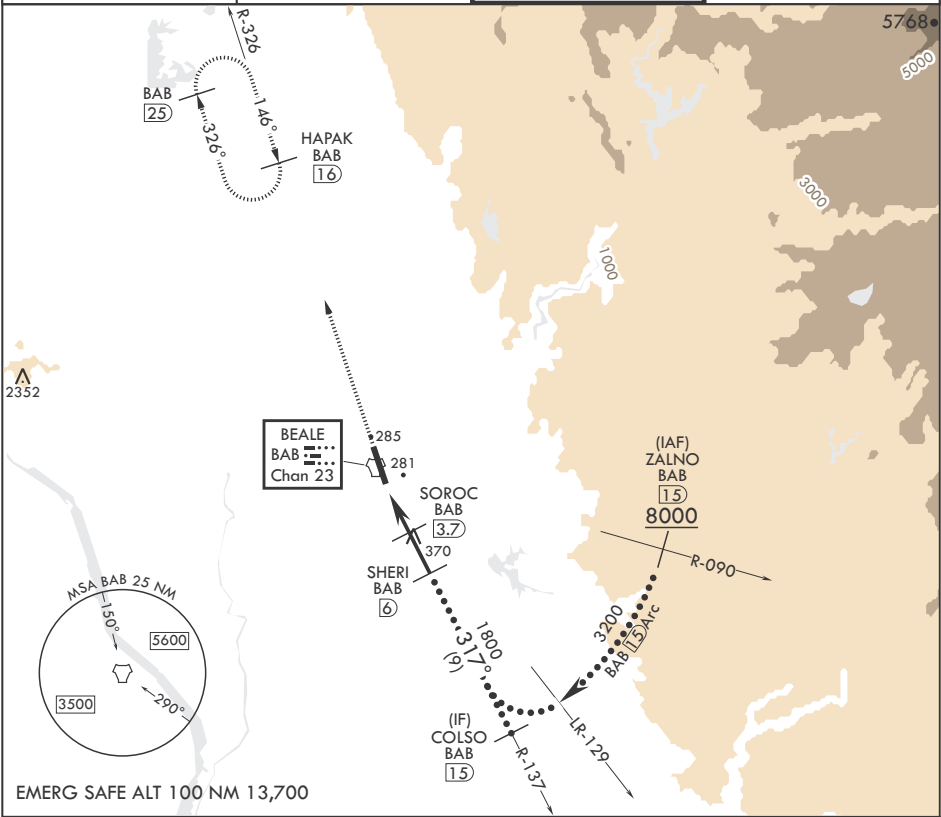

3600
BAB
R-326

HAPAK
BAB
16

COLSO
BAB
15

ELEV 113

TDZE 105

BAB TACAN

EGUYO
BAB
1.5

BAB
2.2

SOROC
BAB
3.7

SHERI
BAB
6

3200

1800

1000

≤ 3.09°
TCH 51

.5

2.2 NM

2.3 NM

CATEGORY	C	D	E
S-33*	540/40	435	(500-34)
CIRCLING**	600-1½ 487 (500-1½)	800-2¼ 687 (700-2¼)	800-2½ 687 (700-2½)

A1

31

BCN
240

TWR
274

13,001 x 300

33

317°

HIRL all Rws

MARYSVILLE, CALIFORNIA

39°08'N - 121°26'W

BEALE AFB (KBAB)

Amtdt 6 25JAN24

HI-TACAN Z RWY 33



SW-2, 02 OCT 2025 to 30 OCT 2025

SW-2, 02 OCT 2025 to 30 OCT 2025