
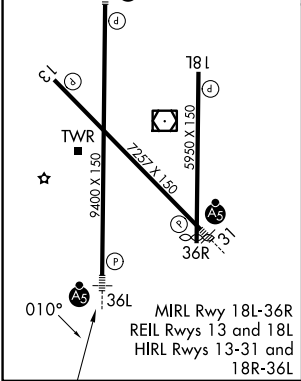



VOR/DME HRL	APP CRS	Rwy Ldg	9400
113.65	010°	TDZE	36
Chan 83 (Y)		Apt Elev	36

VOR RWY 36L
VALLEY INTL (HRL)

DME required.	MAISR	MISSED APPROACH: Climb to 1600 then right turn direct HRL VOR/DME and hold.
When local altimeter setting not received, use Port Isabel altimeter setting and increase all MDAs 60 feet and S-36L visibility Cat C/D ½ SM, and Circling visibility Cat C/D ¼ SM. VDP NA when using PIL altimeter setting.		

ATIS	VALLEY APP CON	HARLINGEN TOWER ★	GND CON	UNICOM
124.85	120.7 279.5	119.3(CTAF) 0 317.6	121.7	122.95

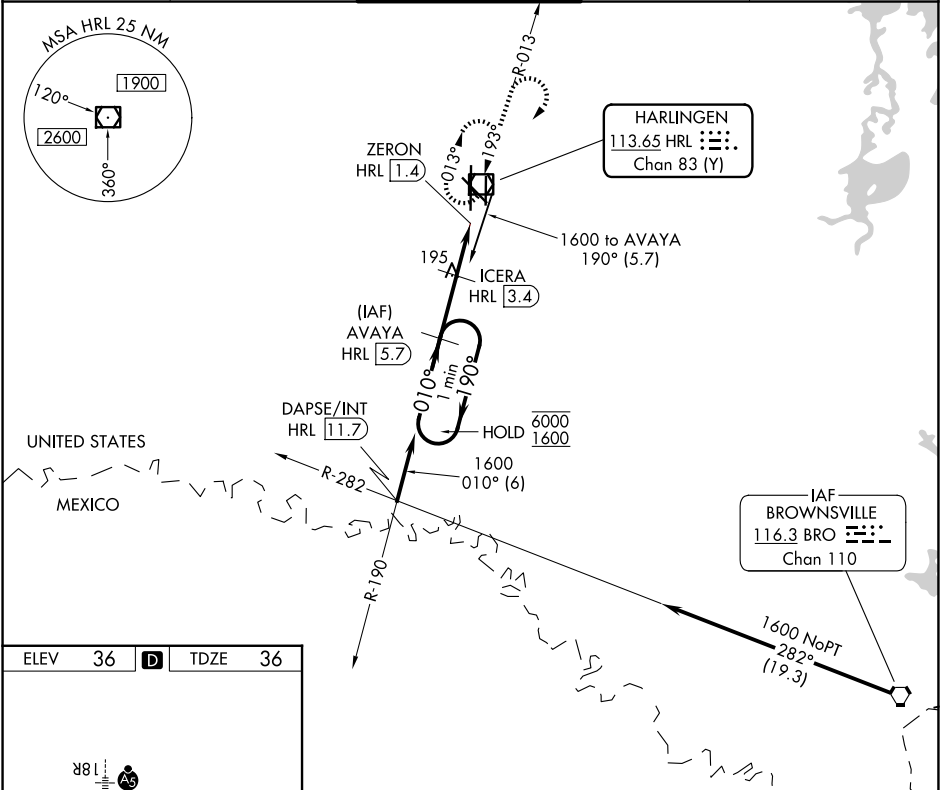

VGSI and descent angles not coincident (VGSI Angle 3.00°/TCH 74).		1600 ↑		HRL 	
One Minute Holding Pattern		AVAYA HRL 5.7		ICERA HRL 3.4	
		010°		HRL 2.1	
3.00° TCH 55		860		ZERON HRL 1.4	
2.3 NM		1.3 NM		0.7 NM	
A		B		C	
S-36L		460-1 424 (500-1)		460-1¼ 424 (500-1¼)	
CIRCLING		460-1 560-1 424 (500-1) 524 (600-1)		600-1½ 680-2 564 (600-½) 644 (700-2)	