

APP CRS 328°	Rwy Idg 5256
	TDZE 933
	Apt Elev 942

RNAV (GPS) RWY 33

GARNER FLD (UVA)


▼

▲


When local altimeter setting not received, use South Texas Rgnl at Hondo altimeter setting and increase all MDA 100 feet; increase LNAV Cat C/D and Circling Cat C/D visibility ¼ SM. DME/DME RNP-0.3 NA.

MISSED APPROACH:
Climbing right turn to 3500
direct BUXQU WP and hold.

AWOS-3 124.175	HOUSTON CENTER 134.95 269.4	UNICOM 122.8 (CTAF) 0
-------------------	--------------------------------	--------------------------

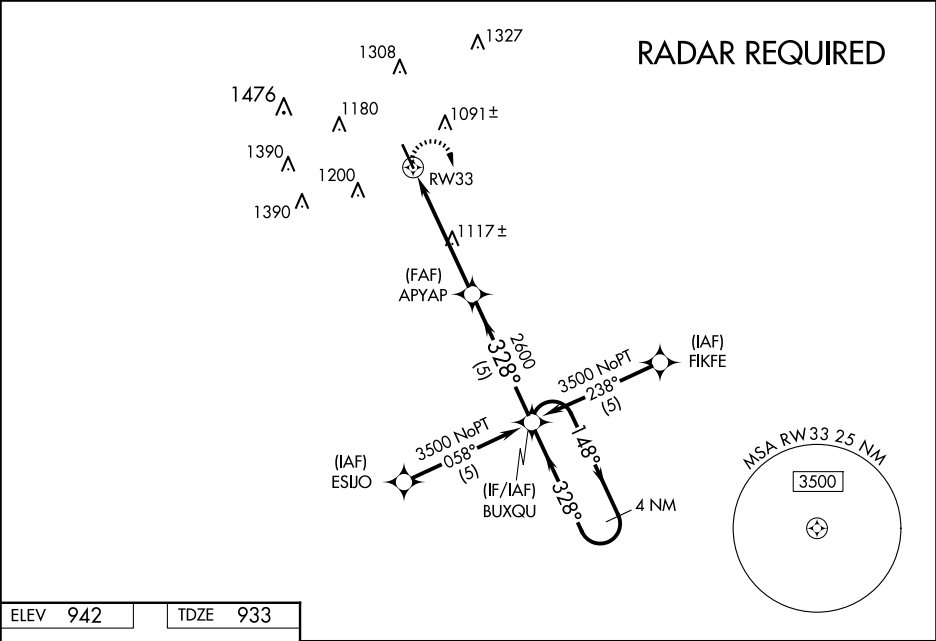

ELEV 942	TDZE 933
----------	----------

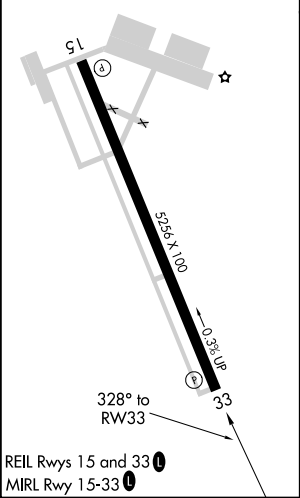

3500

BUXQU

VGSI and descent angle not coincident
(VGSI Angle 3.00/TCH 35).

4 NM

Holding Pattern

CATEGORY	A	B	C	D
GLS DA	NA			
LNAV/ VNAV DA	NA			
LNAV MDA	1380-1 447 (500-1)		1380-1¼ 447 (500-1¼)	1380-1½ 447 (500-1½)
CIRCLING	1380-1 438 (500-1)	1460-1 518 (600-1)	1620-2 678 (700-2)	1620-2¼ 678 (700-2¼)