


WAAS CH 70329 W08A	APP CRS 078°	Rwy Ldg 10200 TDZE 936 Apt Elev 944
--	------------------------	--

RNAV (GPS) Y RWY 8R

ONTARIO INTL (ONT)

▼ For uncompensated Baro-VNAV systems, procedure NA below 2° C (36°F) or above 54°C (130°F). Circling NA north of Rwy 8L-26R. DME/DME RNP-0.3 NA.	MISSED APPROACH: Climb to 1500 then climbing right turn to 5000 direct IBAXE and hold, continue climb-in-hold to 5000.
---	--

D-ATIS 124.25	SOCAL APP CON 127.0 318.2	ONTARIO TOWER 120.6 360.775	GND CON 121.9 257.8	CLNC DEL 132.9	CPDLC
-------------------------	-------------------------------------	---------------------------------------	-------------------------------	--------------------------	-------

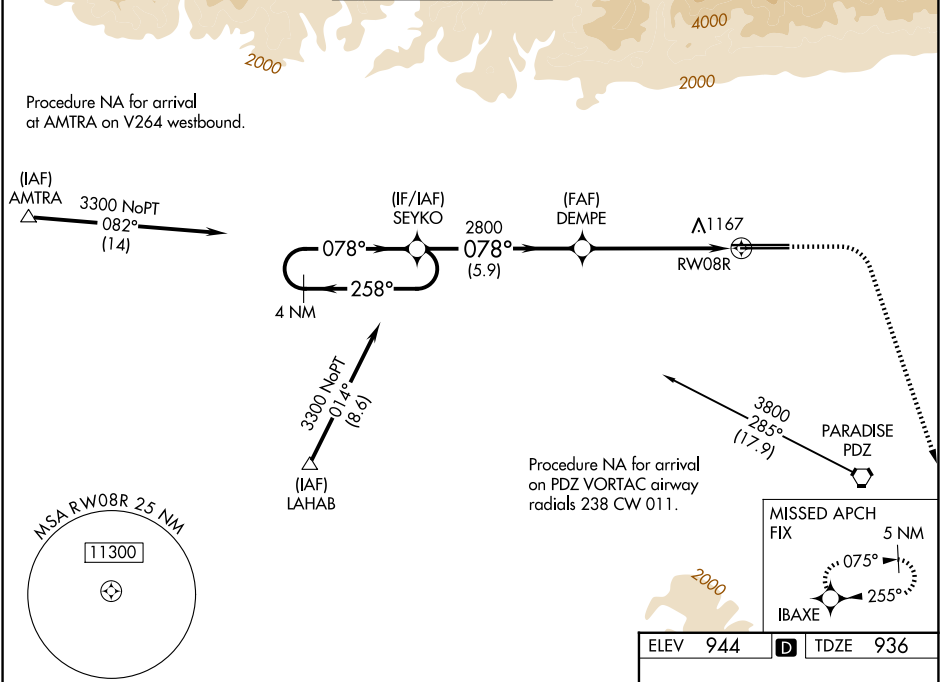

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 65)					1500	5000	IBAXE
4 NM Holding Pattern SEYKO					* LNAV only		
3300 ← 258° 078° →					* 1.4 NM to RW08R		
GP 3.00° TCH 53					RW08R		
					5.9 NM	4.3 NM	1.4 NM
CATEGORY	A	B	C	D			
LPV DA	1220/45 284 (300-7%)						
LNAV/VNAV DA	1494-1 7/8 558 (600-1%)						
LNAV MDA	1440/55 504 (500-1)		1440-1 3/8 504 (500-1%)				
CIRCLING	1440-1 496 (500-1)		1540-1 1/2 596 (600-1 1/2)		1600-2 656 (700-2)		

