

WAAS CH 50516 W09A	APP CRS 095°	Rwy Idg 8003 TDZE 77 Apt Elev 80
--	------------------------	---

RNAV (GPS) RWY 9R

CECIL (VQQ)



▼ Baro-VNAV NA when using Jacksonville Intl altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). DME/DME RNP-0.3 NA.

▲ Helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Jacksonville Intl altimeter setting and increase all DA 52 feet and all MDA 60 feet. For inop MALSR, increase LPV and LNAV/VNAV all Cats visibility to ¾ mile, and LNAV all Cats visibility to 1 mile. For inop MALSR, when using Jacksonville Intl altimeter setting, increase LPV all Cats visibility to 1 mile, LNAV/VNAV all Cats visibility to 1 mile, and LNAV Cats C/D visibility to 1½ mile.

MALSR

MISSED APPROACH:
Climb to 700 then
climbing right turn to
2000 direct COURA
and hold.

ATIS 125.275	JACKSONVILLE APP CON 127.775 377.075	CECIL TOWER★ 126.1 (CTAF) 0 235.625	GND CON 121.625 226.675	CINC DEL 123.975 254.25	GCO 135.075
------------------------	--	--	-----------------------------------	-----------------------------------	-----------------------

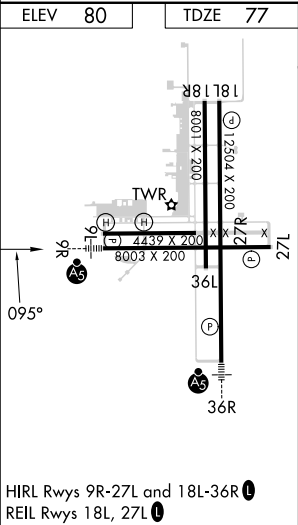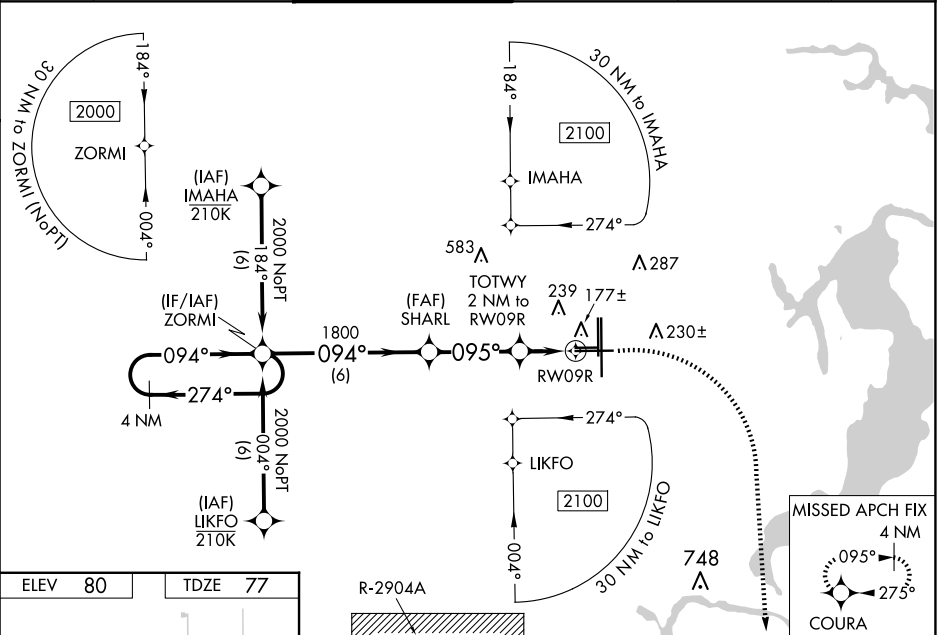

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 68).				
4 NM Holding Pattern				
GP 3.00° TCH 53				
CATEGORY				
LPV DA				
LNAV/VNAV DA				
LNAV MDA				
CIRCLING				