

OCALA, FLORIDA

AL-5055 (FAA)

25275

LOC I-OCF <u>111.5</u>	APP CRS 004°	Rwy Ldg TDZE Apt Elev	6347 80 90
----------------------------------	------------------------	-----------------------------	---------------------------------------

ILS or LOC RWY 36

OCALA INTL-JIM TAYLOR FLD (OCF)

DME required.

MALSR




MISSED APPROACH: Climb to 2000 on OCF VORTAC R-355 to JODON/OCF VORTAC 16 DME and hold.

T
A

DME from OCF VORTAC. DME use requires simultaneous reception of I-OCF and OCF DME. Inop table does not apply to S-ILS 36 all Cats. For inop ALS, increase S-LOC 36 Cats A and B visibility to 1 SM.

ATIS 128.125	JACKSONVILLE APP CON 118.6 251.15	OCALA TOWER ★ 119.25 (CTAF) 0	GND CON 121.4
------------------------	---	---	-------------------------

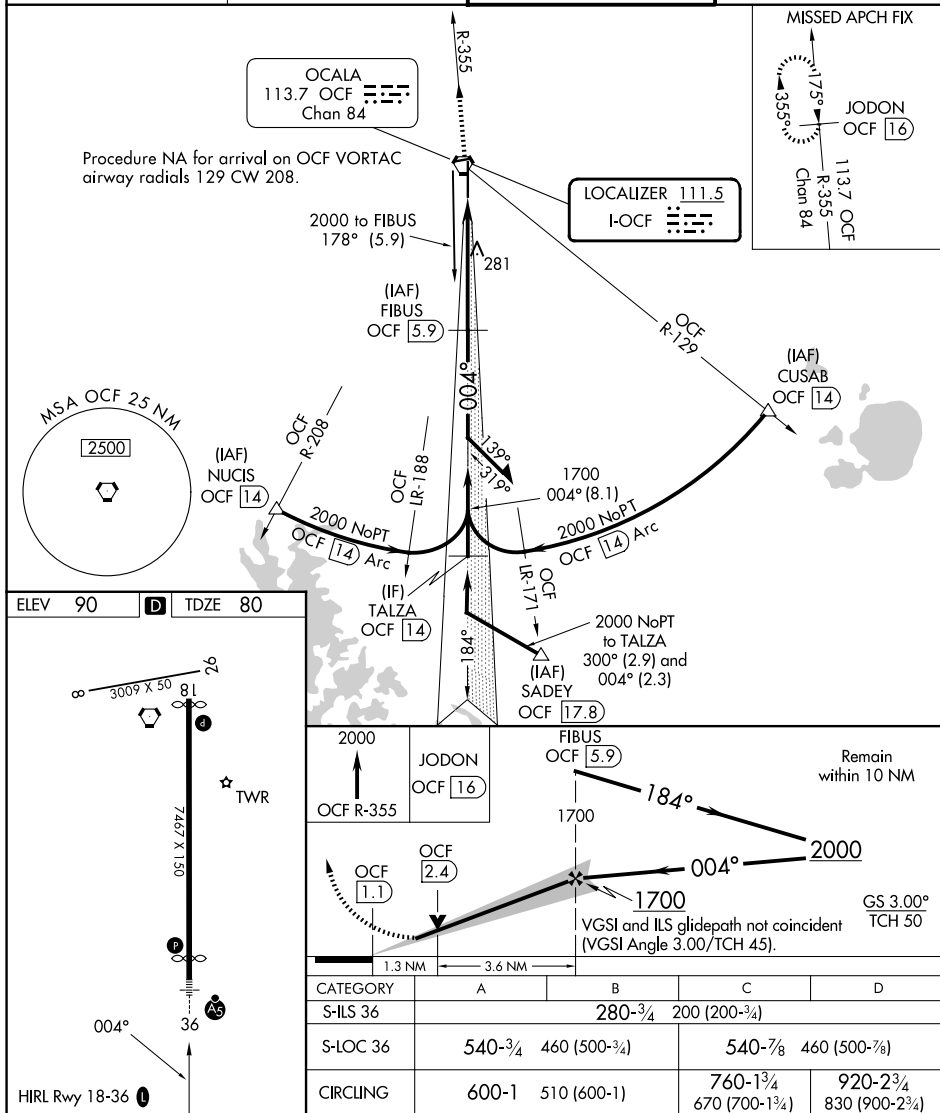

OCALA, FLORIDA

Amdt 2 23FEB23

OCALA INTL-JIM TAYLOR FLD (OCF)

ILS or LOC RWY 36

29°10'N-82°13'W

SE-3, 02 OCT 2025 to 30 OCT 2025

SE-3, 02 OCT 2025 to 30 OCT 2025