


ILS or LOC RWY 30
BUTLER COUNTY RGNL/HOGAN FLD (HAO)

MALS

MISSED APPROACH: Climb to 1600 then climbing right turn to 2600 direct MIZZA and hold.


T Inop table does not apply to S-ILS 30.

UNICOM
123.05 (CTAF) **L**

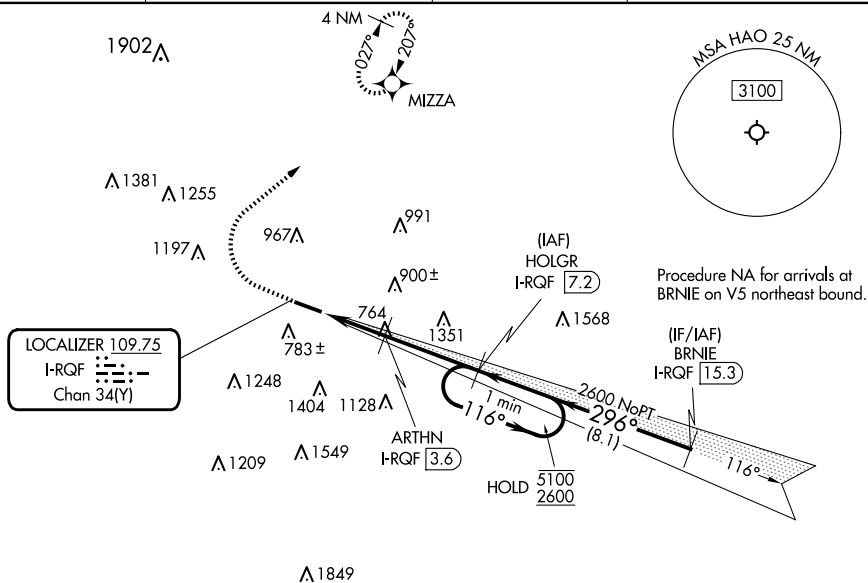


EC-2, 02 OCT 2025 to 30 OCT 2025

ELEV 632		TDZE 619
----------	--	----------

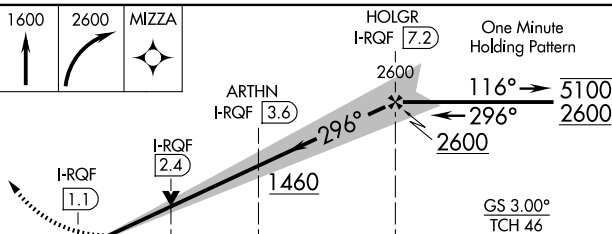

	1.3 NM	1.2 NM	3.6 NM	
CATEGORY	A	B	C	D
S-ILS 30	819-3/4		200 (200-3/4)	
S-LOC 30	1080-3/4	461 (500-3/4)	1080-1 1/8	461 (500-1 1/8)
CIRCLING	1280-1	648 (700-1)	1300-1 3/4 668 (700-1 3/4)	1760-3 1128 (1200-3)

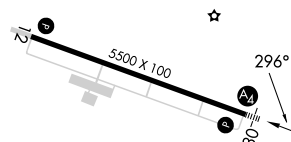

MIRL Rwy 12-30 **L**
REIL Rwy 12 and 30 **L**

FAF to MAP 6.1 NM

Knots	60	90	120	150	180
Min:Sec	6:06	4:04	3:03	2:26	2:02

ILS or LOC RWY 30