

LOC I-POC 110.5	APP CRS 259°	Rwy Ldg TDZE Apt Elev 4151 1005 1014	ILS RWY 26L BRACKETT FLD (POC)	
---------------------------	------------------------	--	-----------------------------------	--


- ▼

Rwy 26L helicopter visibility reduction below ¾ SM NA.

▲

When local altimeter setting not received, use Ontario Intl altimeter setting and increase DA to 1364.
- MISSED APPROACH: Climb to 2100 then climbing left turn to 4000 on POM VORTAC R-164 to PRADO INT/POM 9.3 DME.

D-ATIS 124.4	SOCAL APP CON 125.5 349.0	BRACKETT TOWER★ 118.2 (CTAF) (8R/26L) 133.3 (8L/26R)	GND CON 125.0	CLNC DEL 121.875	UNICOM 122.95
------------------------	-------------------------------------	--	-------------------------	----------------------------	-------------------------

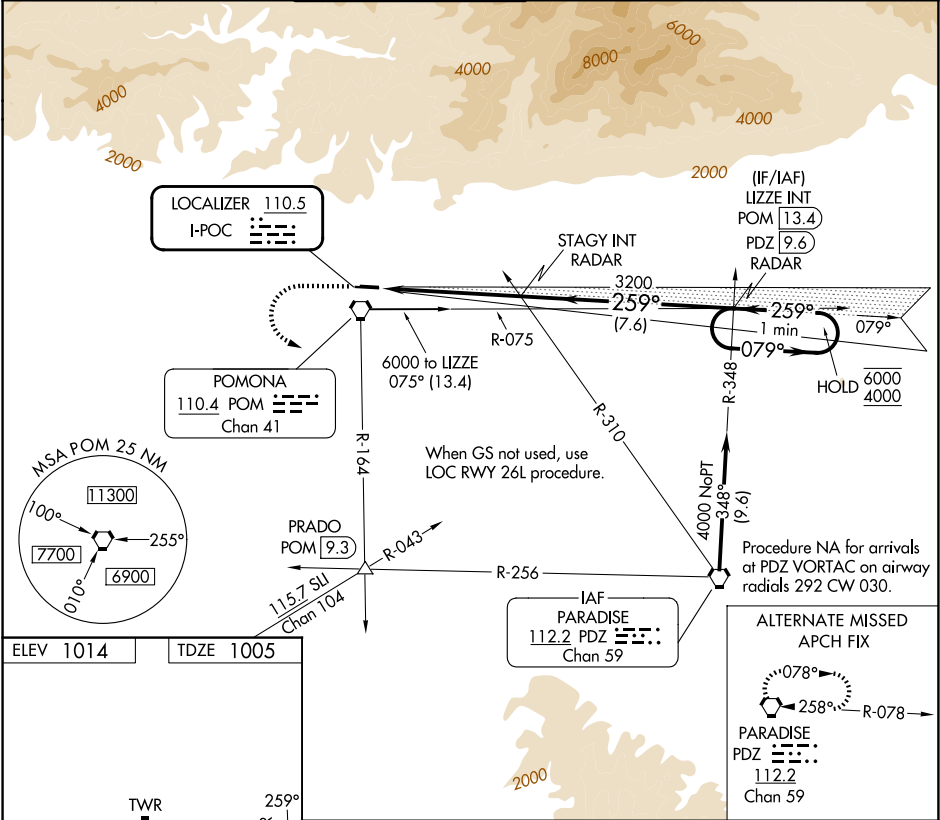

ELEV 1014 TDZE 1005		2100 4000 PRADO		VGS and ILS glidepath not coincident (VGS Angle 3.76/TCH 18).		LIZZE INT PDZ 9.6 RADAR		One Minute Holding Pattern	
TWR 1.0% UP 3661 X 75 259° 26L 26R 0.9% UP 4840 X 75		POM R-164		STAGY INT RADAR 3200 259° 3200		079° 6000 259° 4000		* at DTHR; 60 at Rwy end. GS 3.92% * TCH 20	
REIL Rwys 8R and 26L MRL Rwy 8R-26L		CATEGORY A B C D		S-ILS 26L 1332-1 327 (400-1)		NA			