


LOC/DME I-IAH 109.7 Chan 34	APP CRS 087°	Rwy Ldg 9402 TDZE 95 Apt Elev 96
---	------------------------	---


ILS RWY 8R (SA CAT I & II)
GEORGE BUSH INTCNL/HOUSTON (IAH)

RNAV 1-GPS or RADAR required for procedure entry, DME.	MALSR	MISSED APPROACH: Climb to 3000 on heading 087° and on DAS VORTAC R-242 to DAS VORTAC and hold.
--	-------	--

D-ATIS 124.05	HOUSTON APP CON 120.05 379.1 E 124.35 316.15 W	HOUSTON TOWER 125.35 290.2	GND CON 118.575
-------------------------	--	--------------------------------------	---------------------------

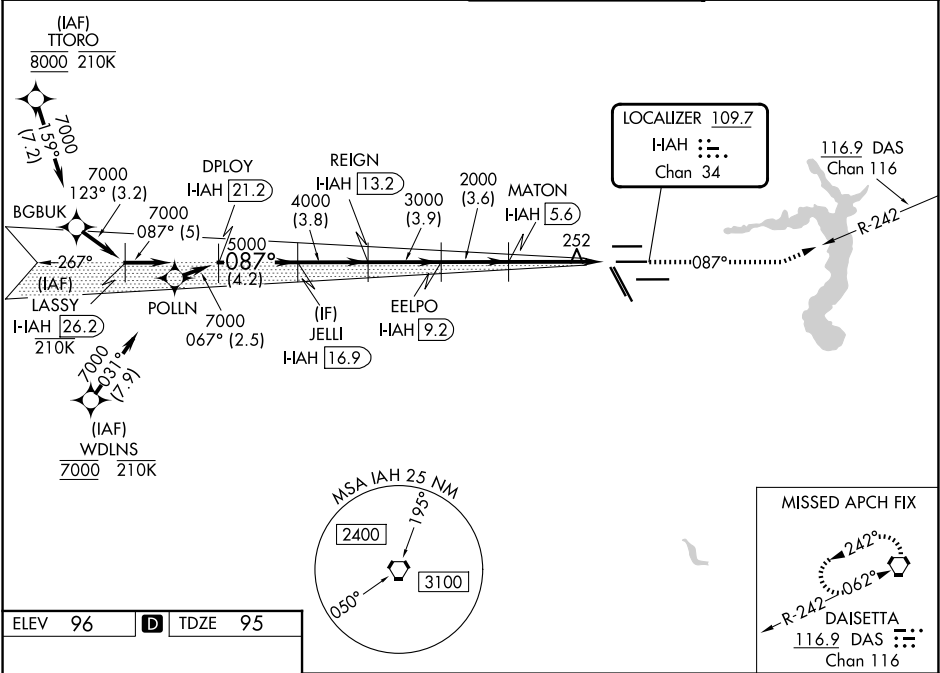

ELEV 96	D	TDZE 95
----------------	----------	----------------

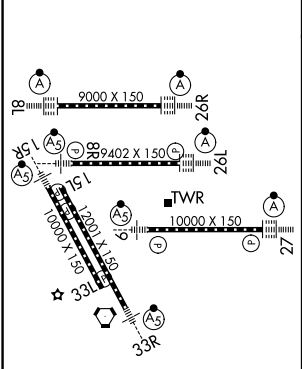

TDZ/CL Rwy 8R, 8L, 15R, 26R, 26L, 27 and 33L
HIRL all Rwy

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 72).				3000	DAS
LASSY I-IAH 26.2	DPLY I-IAH 21.2	JELI I-IAH 16.9	REIGN I-IAH 13.2	EELPO I-IAH 9.2	MATON INT I-IAH 5.6
7000 087°	7000 087°	5000 087°	4000 087°	3000 087°	2000 087°
GS 3.00°	TCH 55				
-5 NM				4.2 NM	3.8
CATEGORY				A	B
S-ILS 8R				SA CAT I RA 152/14	150 DA 245
S-ILS 8R				SA CAT II RA 102/12	100 DA 195

SA CATEGORY I and II ILS SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

SC-5, 02 OCT 2025 to 30 OCT 2025

SC-5, 02 OCT 2025 to 30 OCT 2025