

APP CRS	Rwy Idg	10000
077°	TDZE	29
	Apt Elev	29

RNAV (RNP) Y RWY 8

JACKSONVILLE INTL (JAX)


▼

For uncompensated Baro-VNAV systems, procedure NA below -5°C (23°F) or above 54°C (130°F). GPS required. For inop MALS, increase RNP 0.11 all Cats visibility to 1 mile, increase RNP 0.30 all Cats visibility to 1½ mile.

ALSIF-2

MISSED APPROACH: Climb to 2000 on track 077° to YEJWO and hold.

D-ATIS	JACKSONVILLE APP CON	JACKSONVILLE TOWER	GND CON	CLNC DEL	CPDLC
125.85	119.0 269.9	118.3 317.7	121.9 348.6	119.5 290.275	

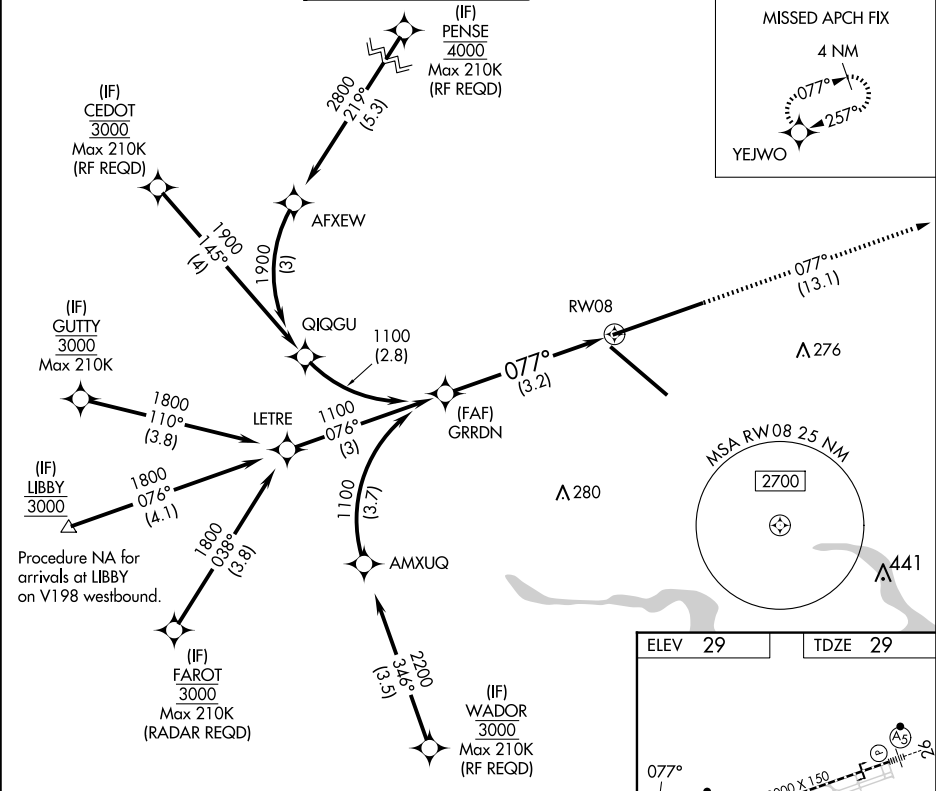

VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 70).

2000

↑

tr 077°

1100

GP 3.00°

TCH 51

GRRDN

1100

077°

RW08

See planview for multiple IF locations.

3.2 NM

CATEGORY	A	B	C	D
RNP 0.11 DA		356/40	327 (400-¾)	
RNP 0.30 DA		426/45	397 (400-¾)	

AUTHORIZATION REQUIRED

ELEV 29

TDZE 29

REIL Rwy 32
TDZ/CL Rwy 8, 14, and 26
HIRL Rwy 8-26 and 14-32

JACKSONVILLE, FLORIDA

Orig-B 30APR15

30°30'N-81°41'W

JACKSONVILLE INTL (JAX)

RNAV (RNP) Y RWY 8