

VOR/DME BJC <u>115.4</u> Chan 101	APP CRS 284°	Rwy Ldg TDZE Apt Elev	30L 7002 5628 5673	30R 9000 5599 5673
---	------------------------	-----------------------------	--	--

VOR/DME RWY 30L/R
ROCKY MOUNTAIN METRO (B:JC)

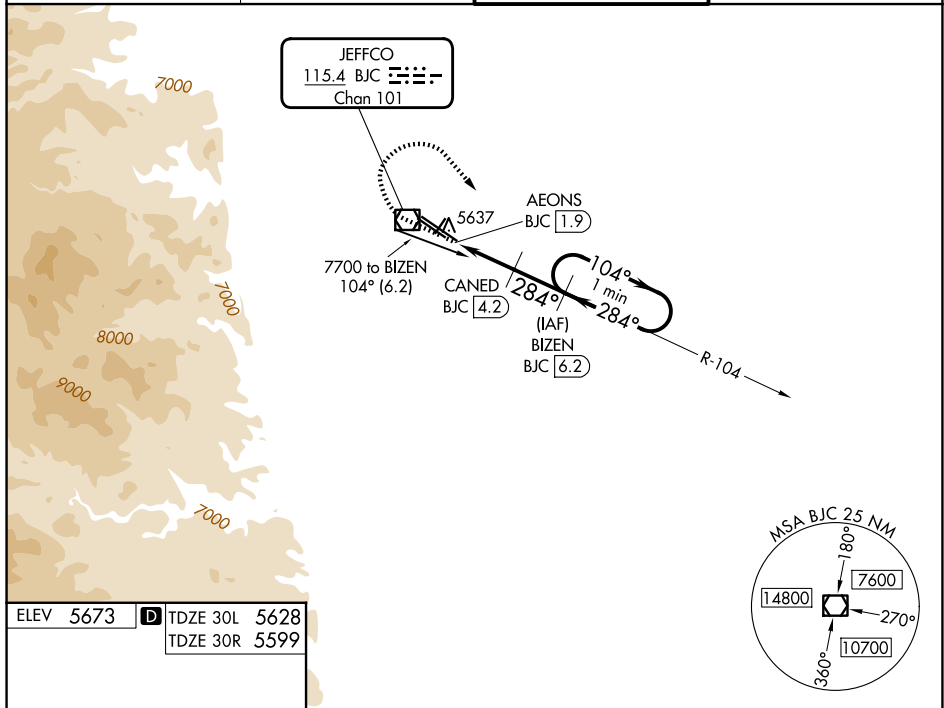
V
A NA

When local altimeter setting not received, use Denver Intl altimeter setting and increase all MDA 100 feet. Increase S-30L Cats C/D visibility to 1 mile and Circling Cat C to 2 1/4 mile. For inoperative MALSR, increase S-30R all Cats visibility to 1 mile. For inoperative MALSR, when using Denver Intl altimeter setting, increase S-30R Cats C/D visibility to 1 1/8 mile.

MALSR
Rwy 30R

MISSED APPROACH: Climb to 6100 then climbing right turn to 7000 on heading 150° and on BJC VOR/DME R-104 to BJZEN/BJC 6.2 DME and hold.

ATIS 126.25	DENVER APP CON 125.12 263.02	METRO TOWER* 118.6 (CTAF) 0 233.7	GND CON 121.7
-----------------------	--	---	-------------------------

[illegible][illegible]