

LOC I-LQG <u>111.7</u>	APP CRS 073°	Rwy Idg 5002 TDZE 793 Apt Elev 793
----------------------------------	------------------------	---

ILS or LOC RWY 7
LORAIN COUNTY RGNL (LPR)



T For inoperative MALS, increase S-LOC 7 Cats C/D visibility to 1 $\frac{3}{8}$ mile.
A VDP NA with Cleveland-Hopkins Intl altimeter setting. When local altimeter setting not received, use Cleveland-Hopkins Intl altimeter setting and increase all DA 36 feet and all MDA 40 feet.

MALSR

MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 on heading 270° then left turn direct DJB VOR/DME and hold.

ASOS 118.925	CLEVELAND APP CON 125.35 346.325	CLNC DEL 125.7	UNICOM 122.7 (CTAF) ①
------------------------	--	--------------------------	---------------------------------

DME REQUIRED

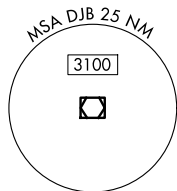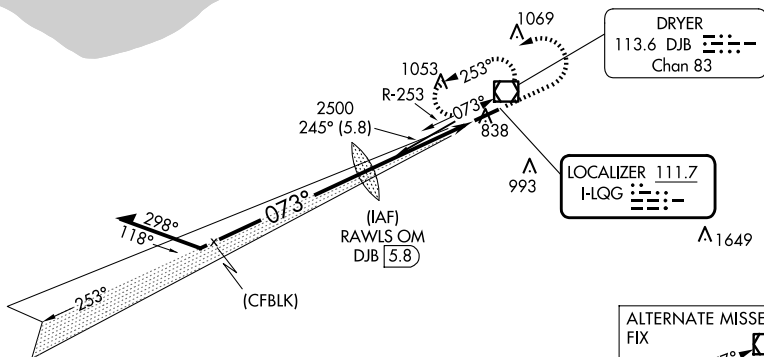

ALTERNATE MISSED APCH
FIX

R-257-077°

257°

DRYER

DJB


113.6

Chan 83

ELEV 793	TDZE 793
----------	----------

FAF to MAP 4.4 NM

Knots	60	90	120	150	180
Min:Sec	4:24	2:56	2:12	1:46	1:28

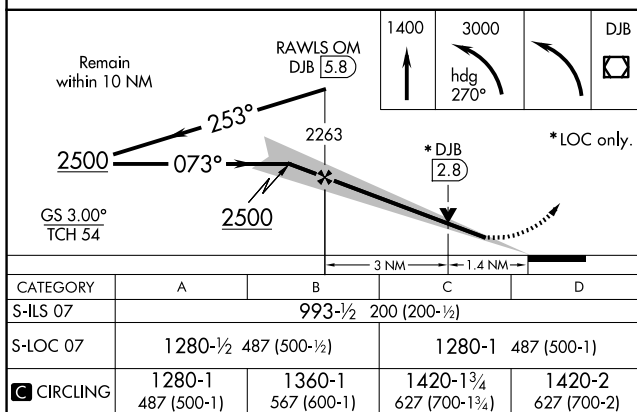

ILS or LOC RWY 7