

LOM BU	APP CRS	Rwy Ldg	5500
230	038°	TDZE	904
		Apt Elev	904

NDB RWY 4
BOLTON FLD (TZR)

RADAR required for procedure entry.


▼ For inop ALS, increase S-4 Cats A/B visibility to 1 SM and S-4 Cats C/D visibility to 1½ SM.

▲

MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 2700 direct BU LOM and hold.

AWOS-3PT 135.925	COLUMBUS APP CON 134.0 279.6	BOLTON TOWER★ 128.1 (CTAF) 0	GND CON 121.8
---------------------	---------------------------------	---------------------------------	------------------

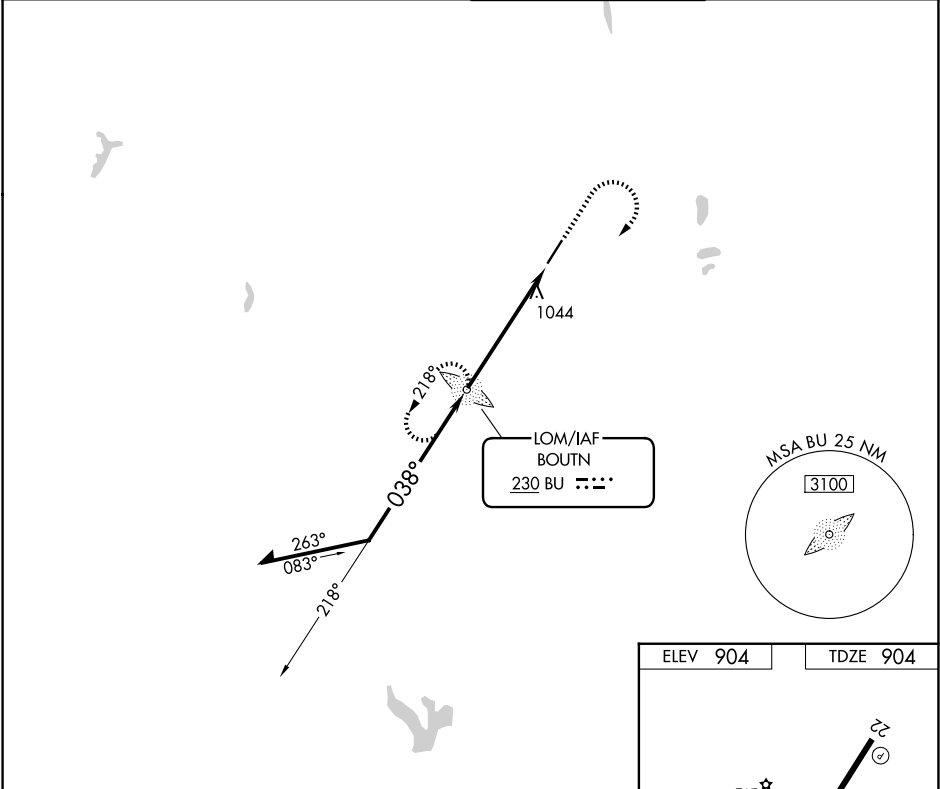

Remain within 10 NM

2700

218°

038°

BU LOM

1400

2700

BU

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25).

3.08°

TCH 40

5.4 NM

CATEGORY	A	B	C	D
S-4	1400-¾	496 (500-¾)	1400-1 496 (500-1)	1400-1¼ 496 (500-1¼)
CIRCLING	1400-1	496 (500-1)	1400-1½ 496 (500-1½)	1500-2 596 (600-2)

ELEV	904	TDZE	904
------	-----	------	-----

5500 X 100

TWR

REIL Rwy 22

MRL Rwy 4-22

038°

FAF to MAP 5.4 NM

Knots	60	90	120	150	180
Min:Sec	5:24	3:36	2:42	2:10	1:48

EC-2, 02 OCT 2025 to 30 OCT 2025

EC-2, 02 OCT 2025 to 30 OCT 2025