


APP CRS
313°

Rwy Idg **4500**
TDZE **429**
Apt Elev **429**

RNAV (GPS) RWY 31
MOUNT CARMEL MUNI (AJG)

RNP APCH. ▼ ▲ NA When local altimeter setting not received, use Lawrenceville altimeter setting and increase all MDA 40 feet and increase LNAV Cat D visibility ¼ mile.		MISSED APPROACH: Climbing left turn to 2500 direct NIYRI and hold.
AWOS-3 134.9	EVANSVILLE APP CON★ 125.6 343.7	UNICOM 122.7 (CTAF) 0

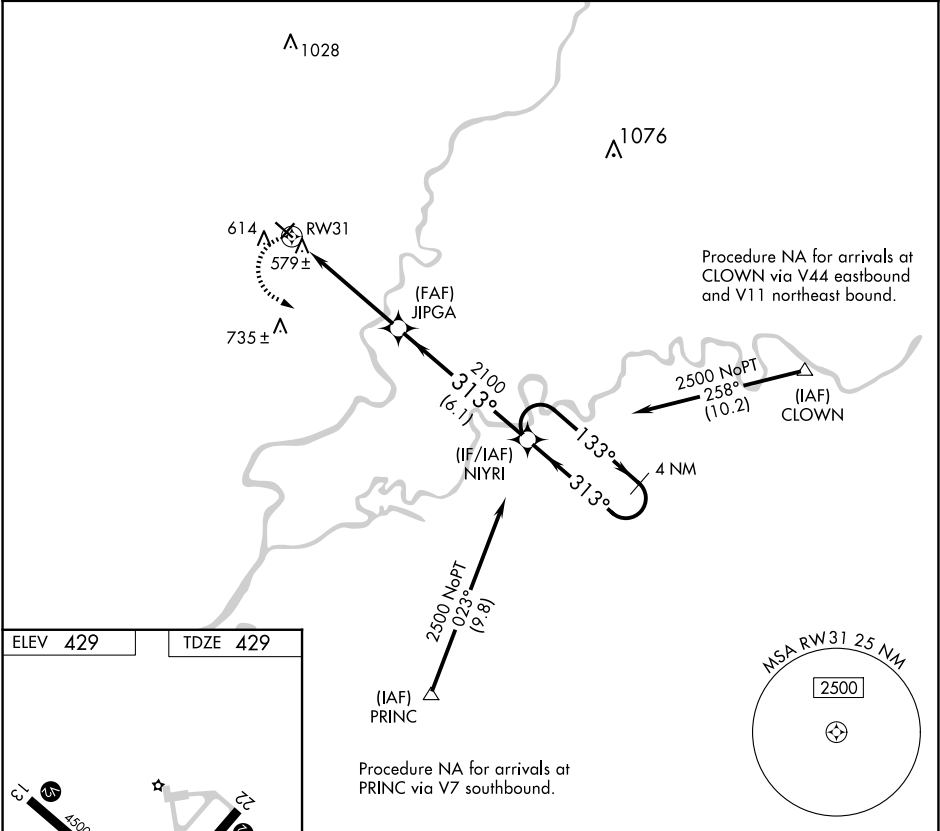

ELEV 429

TDZE 429

REIL Rws 4, 13, 22 and 31

MIRL Rws 4-22 and 13-31

2500 NIYRI		VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25).		NIYRI 4 NM Holding Pattern	
RW31		JIPGA		NIYRI	
5 NM		6.1 NM		4 NM	
CATEGORY	A	B	C	D	
LNAV MDA	840-1	411 (500-1)	840-1¼	411 (500-1¼)	