

WAAS CH 97701 W10A	APP CRS 100°	Rwy Ldg TDZE 857 Apt Elev 868
--	------------------------	---

RNAV (GPS) RWY 10

FAIRFIELD COUNTY (LHQ)

RNP APCH - GPS.


▼

Rwy 10 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Rickenbacker Intl altimeter setting and increase all MDAs 60 feet and LNAV visibility Cat C ¼ SM, and Circling visibility Cat C ¼ SM. When Circling Rwy 28 at night, operational VGSI required, remain on or above VGSI glidepath until threshold.

MISSED APPROACH:

Climb to 2800 direct
DIPAC and hold.

ASOS 118.375	COLUMBUS APP CON 134.0 279.6	CLNC DEL 121.65	UNICOM 122.725 (CTAF)
------------------------	--	---------------------------	---------------------------------

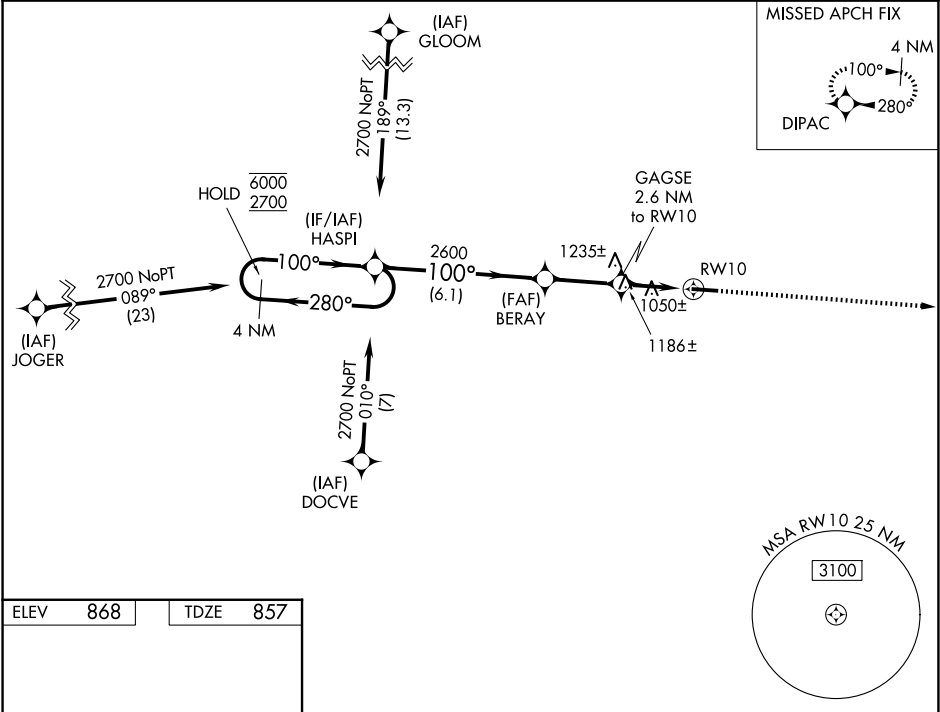

ELEV 868	TDZE 857
-----------------	-----------------

100°

10

5003 X 75

82

4 NM Holding Pattern

HASPI

6000

2700

280°

100°

100°

BERY

2600

3.00°

TCH 40

1720

GAGSE 2.6 NM to RWY 10

RWY 10

2800

DIPAC

6.1 NM

2.8 NM

2.6 NM

CATEGORY	A	B	C	D
LP MDA	1300-1	443 (500-1)	1300-1½ 443 (500-1½)	NA
LNAV MDA	1440-1	583 (600-1)	1440-1¾ 583 (600-1¾)	NA
CIRCLING	1500-1 632 (700-1)	1540-1 672 (700-1)	1620-2¼ 752 (800-2¼)	NA