

MONTE VISTA, COLORADO

AL-6427 (FAA)

25163



WAAS CH 45840 W20A	APP CRS 201°	Rwy Ldg 5902 TDZE 7610 Apt Elev 7611
--	------------------------	---

RNAV (GPS) RWY 20
MONTE VISTA MUNI (MVI)

T Circling NA to Rwy 10, 28, 16 and 34. DME/DME RNP-0.3 NA.
A Baro-VNAV NA. Use Alamosa altimeter setting.


MISSED APPROACH: (Do not exceed 190K until LOGBY) Climb to 8100 on heading 201° then climbing right turn to 9700 direct LOGBY and hold.

ALS AWOS-3 135.175	DENVER CENTER 128.375 379.95	UNICOM 122.8 (CTAF) ①
------------------------------	--	---------------------------------

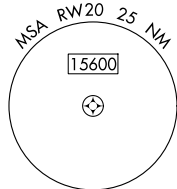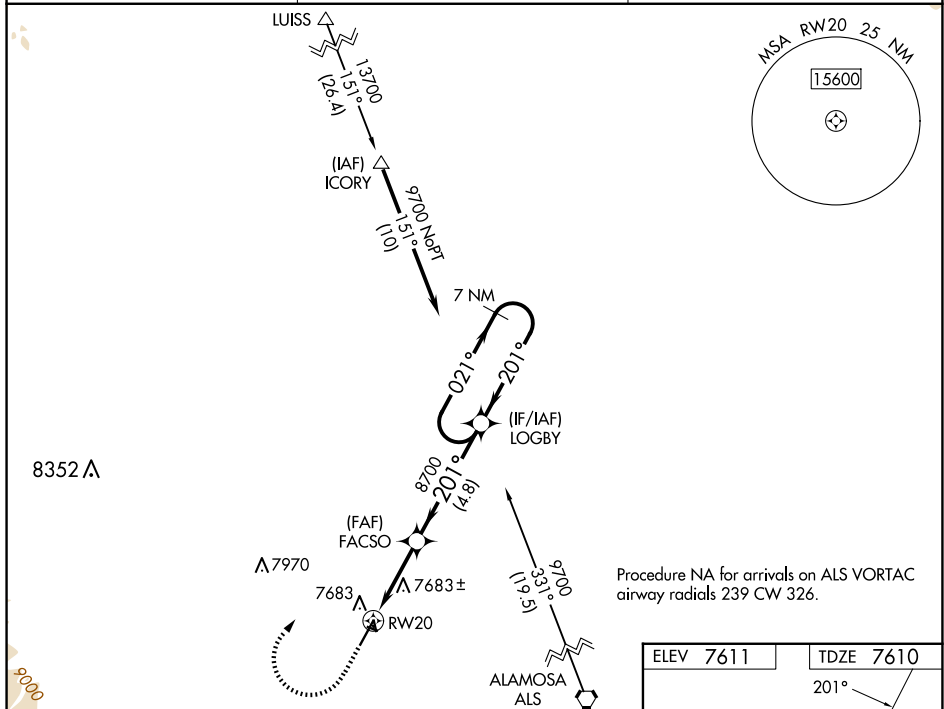

Procedure NA for arrivals on ALS VORTAC
airway radials 239 CW 326.

8100 hdg 201° 9700 LOGBY 		VGS1 and RNAV glidepath not coincident (VGS1 Angle 3.00/TCH 38).			
RW20 		FACSO 		LOGBY 	
3.3 NM		4.8 NM		7 NM Holding Pattern	
201°		201°		021°	
8700		8700		9700	
GP 3.00° TCH 52					
CATEGORY		A		B	
LPV DA		7894-1		284 (300-1)	
RNAV/ VNAV DA		7894-1		284 (300-1)	
RNAV MDA		7980-1		370 (400-1)	
CIRCLING		8060-1 449 (500-1)		8080-1 469 (500-1)	
		8180-1½ 569 (600-1½)		8360-2½ 749 (800-2½)	

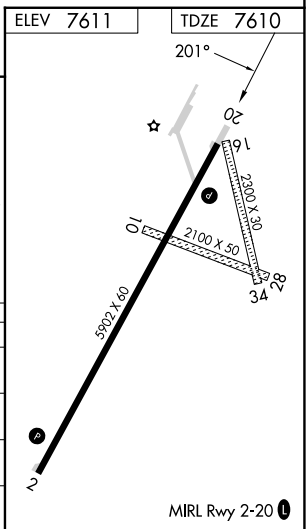

MONTE VISTA, COLORADO
Orig 14SEP17

37°32'N-106°03'W

MONTE VISTA MUNI (MVI)
RNAV (GPS) RWY 20

SW-1, 02 OCT 2025 to 30 OCT 2025