

WAAS CH 69418 W25A	APP CRS 247°	Rwy Idg 3434 TDZE 8 Apt Elev 9
--	------------------------	---

RNAV (GPS) RWY 25

BEAUFORT EXEC (A.R.W.)



⚠

ASR

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use Beaufort MCAS (Merritt Fld) altimeter setting and increase LPV DA to 226, LNAV/VNAV DA to 352, and all MDA 20 feet. VDP and Baro-VNAV NA when using Beaufort MCAS (Merritt Fld) altimeter setting.

MISSED APPROACH:
Climb to 2000 direct
EROMY and hold.

AWOS-3 119.675	BEAUFORT APP CON★ 125.125 292.125	UNICOM 122.7 (CTAF) 0
--------------------------	---	---------------------------------

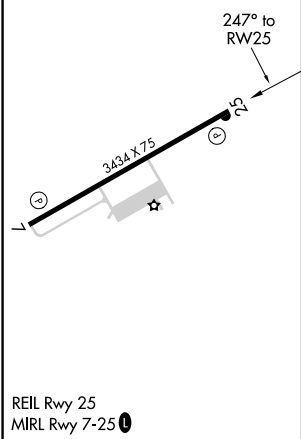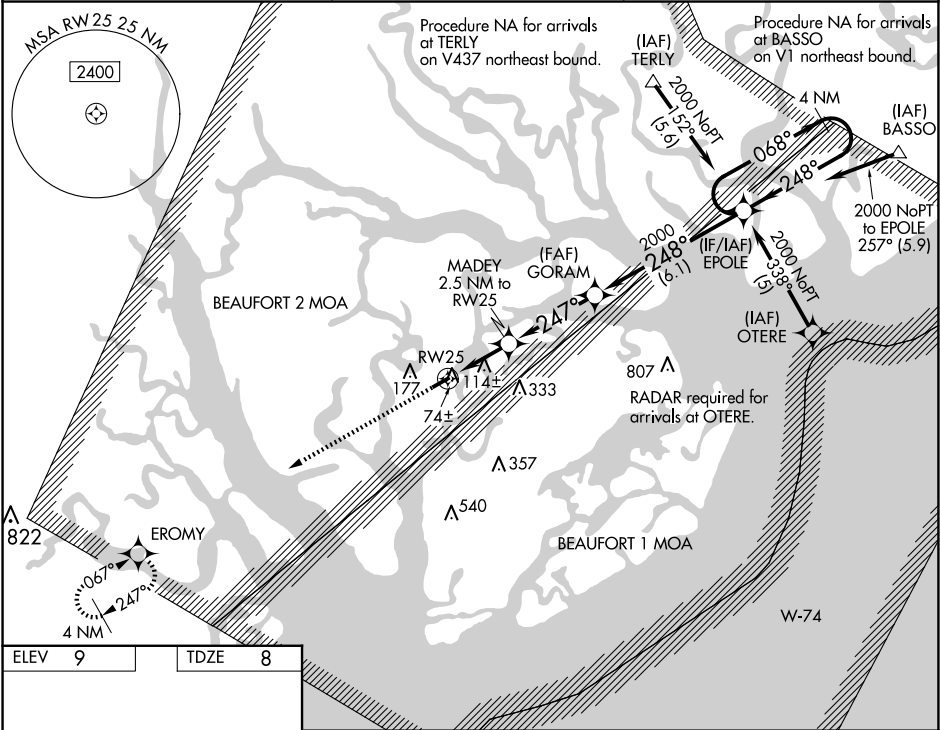

2000 ↑	EROMY ✦	VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 25).			
*LNAV only.		MADEY 2.5 NM to RW25	GORAM 2000	EPOLE	4 NM Holding Pattern
*1.1 NM to RW25		247°		248°	2000
RW25		*840		248°	2000
-1.1		-1.4	3.5 NM	6.1 NM	GP 3.00° TCH 40
CATEGORY	A		B	C	D
LPV DA	208-1		200 (200-1)		NA
LNAV/ VNAV DA	334-1¼		326 (400-1¼)		NA
LNAV MDA	380-1		372 (400-1)		NA
CIRCLING	480-1		471 (500-1)	640-1¾ 631 (700-1¾)	NA

SE-2, 02 OCT 2025 to 30 OCT 2025

SE-2, 02 OCT 2025 to 30 OCT 2025