


APP CRS	Rwy Idg	5022
020°	TDZE	3090
	Apt Elev	3090

RNAV (GPS) RWY 2

MAJOR SAMUEL B CORNELIUS FLD (E42)

▼ DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. Use Borger altimeter setting; when not received, use Rick Husband Amarillo Intl altimeter setting and increase all MDA 140 feet, increase LNAV Cat B visibility ¼ mile, LNAV Cat C visibility ½ mile, Circling Cat A visibility ¼ mile, and Circling Cat C visibility ½ mile.	⚠ NA	MISSED APPROACH: Climbing left turn to 6000 direct OYUSA hold.
---	--------------------------------------	---

AWOS-3P 118.925	ALBUQUERQUE CENTER 127.85 285.475	CTAF 122.9
--------------------	--------------------------------------	---------------

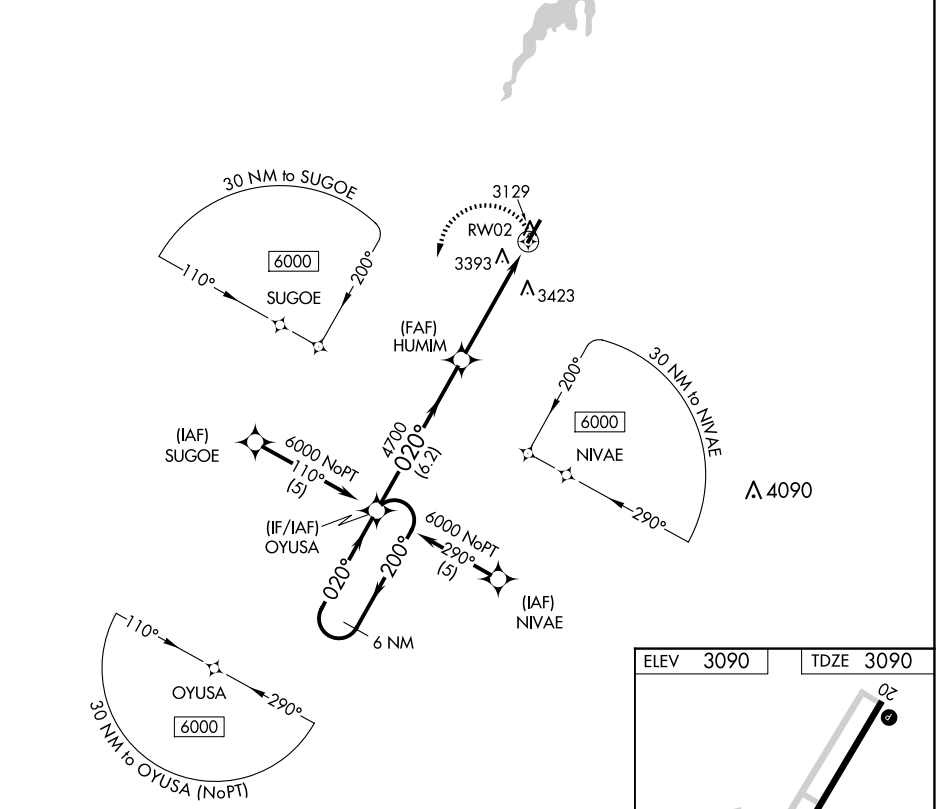

6 NM

Holding Pattern

VGSI and descent angles not coincident

(VGSI Angle 3.00/TCH 39).

6000

OYUSA

6000

← 200°

020° →

OYUSA

HUMIM

4700

020°

3.04° ≥ TCH 40

RW02

6.2 NM

4.9 NM

CATEGORY	A	B	C	D
LNAV MDA	3780-1	690 (700-1)	3780-2 690 (700-2)	NA
CIRCLING	3840-1 750 (800-1)	3840-1¼ 750 (800-1¼)	3840-2¼ 750 (800-2¼)	NA

