

24305

Rwy Idg	6952
TDZE	487
Apt Elev	487

DALLAS LOVE FLD (DAL)

T For uncompensated Baro-VNAV systems, procedure NA below -5°C (23°F) or above 54°C (130°F). Use of FD or AP providing RNAV track guidance required during simultaneous operations. Simultaneous approach authorized.


MISSED APPROACH: Climb to 900 then climbing right turn to 5000 direct **FINGR** and hold.

LONE STAR APP CON
NORTH **124.3 282.275**
SOUTH **125.2 343.65**

GND CON
121.75 348.6

CLNC DEL
127.9

CPDLC

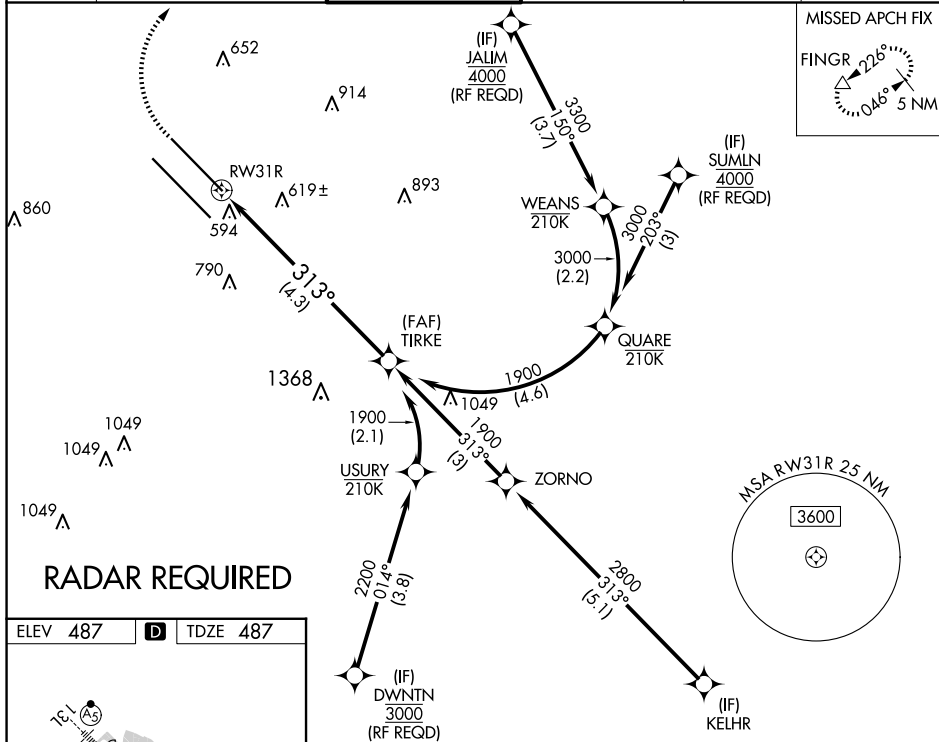


RADAR REQUIRED

ELEV 487

□

TDZE 487

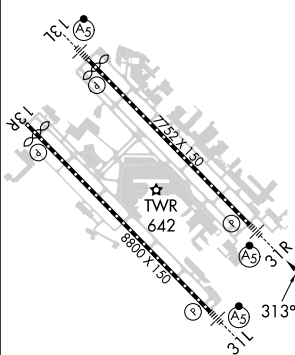

TDZ/CL Rwy 13L and 31L
HIRL Rwy 13L-31R, and 13R-31L


900

50

FINGR

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 55).

See planview for multiple IF locations.

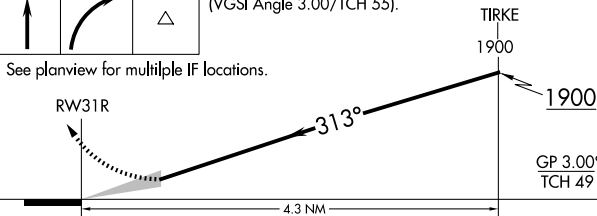

CATEGORY	A	B	C	D
RNP 0.16 DA		796/24	309 (400-1/2)	
RNP 0.30 DA		895/45	408 (500-7/8)	

AUTHORIZATION REQUIRED

Orig-C 31JAN19

DALLAS LOVE FLD (DAL)

32°51'N-96°51'W

RNAV (RNP) Z RWY 31R

SC-2, 30 OCT 2025 to 27 NOV 2025