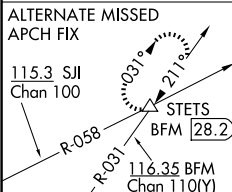


ILS or LOC RWY 32
MOBILE INTL (BFM)

MISSED APPROACH: Climb to 800 then climbing right turn to 2000 on heading 030° and on SJI R-058 to STETS INT/SJI 35.9 DME and hold.

A5

GND CON
121.7 239.3

REIL Rwy 14
MIRL Rwy 18-36
HIRL Rwy 14 22

800	2000	SJI	STETS
↑	hdg 030°	R-058	△

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 71).

LURDE
I-RUJ [6.9]
RADAR

ROKGO
I-RUJ [13.9]
RADAR

One Minute Holding Pattern

DEXOW
I-RUJ [3.4]

I-RUJ [1.8]

I-RUJ [2.6]

1700

320°

140° →

← 320°

6000

1700

580

1700

GS 3.00°
TCH 55

SE-4, 30 OCT 2025 to 27 NOV 2025