

LOC/DME I-MRY 110.7 Chan 44	APP CRS 098°	Rwy Ldg 7000 TDZE 198 Apt Elev 257
---	------------------------	---

ILS or LOC RWY 10R
MONTEREY RGNL (MRY)

DME required.

▼


▲

Circling NA south of Rwy 10R-28L.
For inop ALS, increase S-ILS 10R all Cats visibility to RVR 6000,
and increase S-LOC 10R Cat C and D visibility to 2 SM.

MALSR

MISSED APPROACH: Climb to 600 then
climbing left turn to 5000 on heading 030°
and on SNS VORTAC R-243 to SNS VORTAC
and hold, continue climb-in-hold to 5000.
Missed approach requires minimum climb
of 265 feet per NM to 1360.

ATIS 119.25	NORCAL APP CON 133.0 251.15 (001°-135°) 127.15 307.125 (136°-360°)	MONTEREY TOWER ★ 118.4 (CTAF) 257.8	GND CON 120.875 348.6	UNICOM 122.95
-----------------------	--	--	---------------------------------	-------------------------

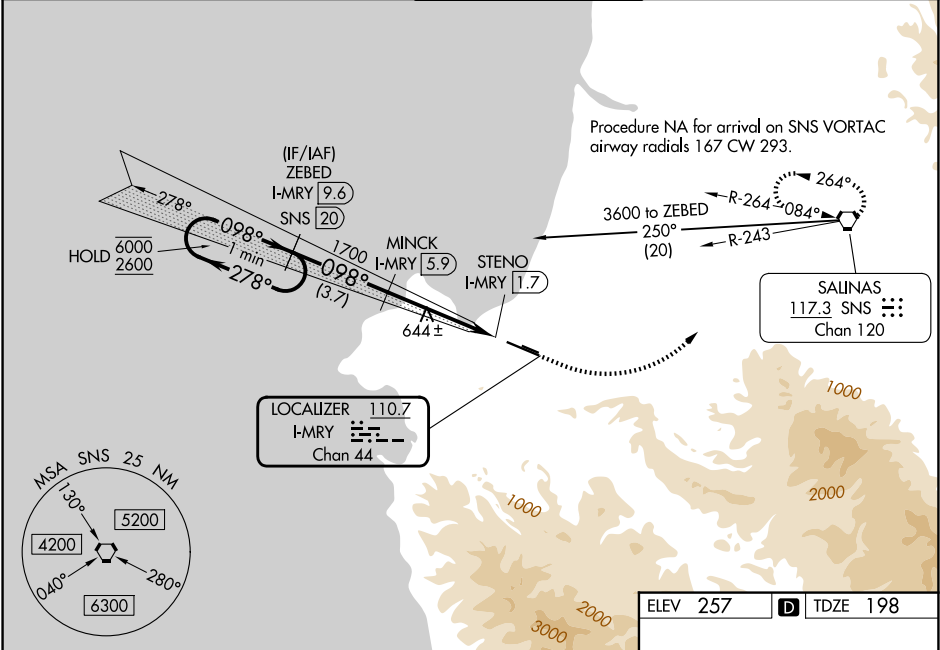

ILS unusable from 1.7 DME inbound.

One Minute Holding Pattern

6000
2600

278°

098°

1700

098°

1700

3.7 NM

2.5 NM

1.7 NM

0.5 NM

GS 3.00°

TCH 45

600

5000

hdg 030°

SNS R-243

SNS

LOCALIZER 110.7

I-MRY

Chan 44

CATEGORY	A	B	C	D
S-ILS 10R#	398/24 200 (200-½)			
S-ILS 10R	583/35 385 (400-¾)			
S-LOC 10R	920/24 722 (700-½)		920-1½ 722 (700-1¾)	
CIRCLING	920-1 663 (700-1)		1280-3 1023 (1100-3) NA	

ELEV 257

TDZE 198

MIRL Rwy 10L-28R

HIRL Rwy 10R-28L

REIL Rwy 28L

REIL Rwy 10L and 28R

SW-2, 30 OCT 2025 to 27 NOV 2025

SW-2, 30 OCT 2025 to 27 NOV 2025