



VORTAC FSD 115.0 Chan 97	APP CRS 147°	Rwy Ldg 8000 TDZE 1429 Apt Elev 1430
--	------------------------	---

VOR or TACAN RWY 15
JOE FOSS FLD (FSD)


 Rwy 15 helicopter visibility reduction
 below $\frac{3}{4}$ SM NA.
 -30°C

MISSED APPROACH: Climb to 3500 then right turn direct FSD VORTAC and hold. (TACAN aircraft continue climb to 5000 via FSD R-269 to FRYRE 15 DME and hold west, right turns, 089° inbound)

ATIS 126.6	SIoux FALLS APP CON★ 125.8 284.725	SIoux FALLS TOWER★ 118.3(CTAF) 0 257.8	GND CON 121.9 348.6	UNICOM 122.95
---------------	---------------------------------------	---	------------------------	------------------

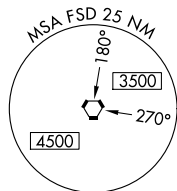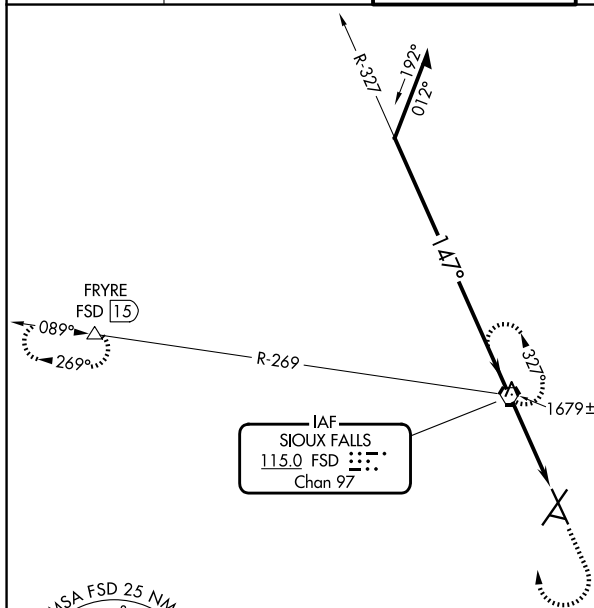

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 48).	FSD VORTAC
--	---------------

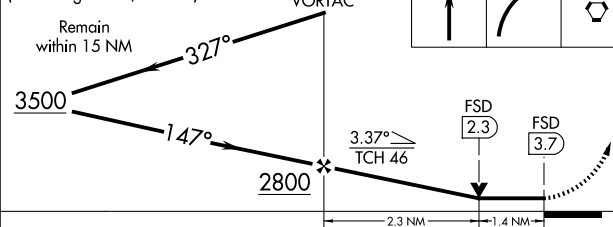

CATEGORY	A	B	C	D	E
S-15	1920-1	491 (500-1)	1920-1 $\frac{3}{8}$ 491 (500-1 $\frac{3}{8}$)		
CIRCLING	1960-1 530 (600-1)	1980-1 550 (600-1)	2060-1 $\frac{3}{4}$ 630 (700-1 $\frac{3}{4}$)	2200-2 $\frac{1}{2}$ 770 (800-2 $\frac{1}{2}$)	2300-3 870 (900-3)

