


LOC/DME I-TWJ 111.95 Chan 56 (Y)	APP CRS 007°	Rwy Ldg TDZE Apt Elev 8300 21 26
--	------------------------	--

LOC RWY 1R
TAMPA INTL (TPA)


DME required.		MISSED APPROACH: Climb to 500 then climbing right turn to 2000 direct LAL VORTAC and hold.			
---------------	--	--	--	--	--

ARR 126.45	D-ATIS 128.475	DEP 128.475	TAMPA APP CON 118.5 307.175	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4	CLNC DEL 133.6	CPDLC
----------------------	--------------------------	-----------------------	---------------------------------------	-----------------------------------	-------------------------------	--------------------------	-------

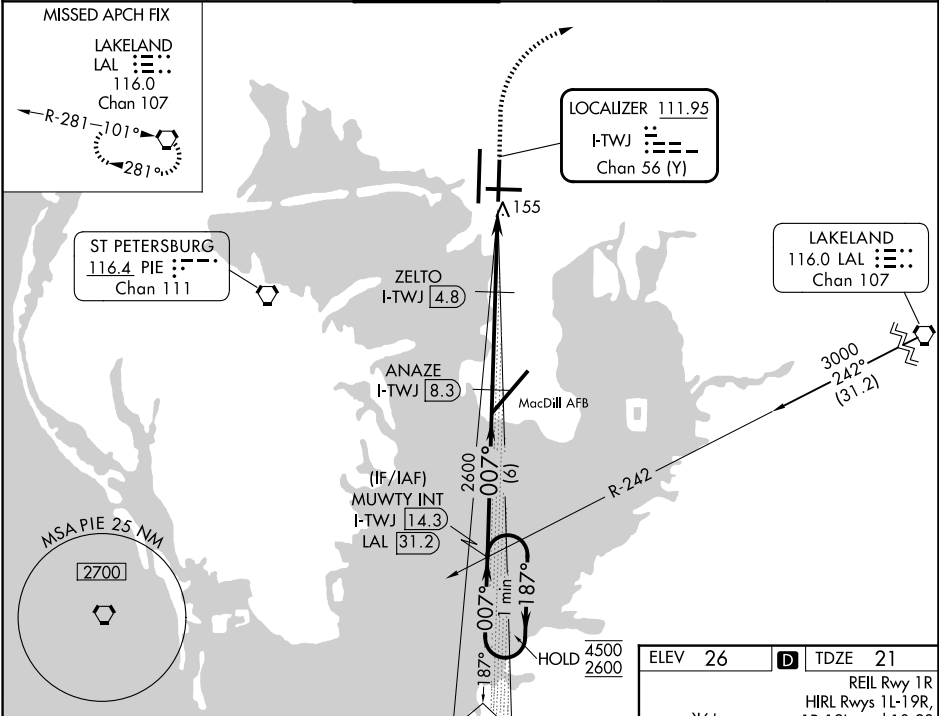

VGSI and descent angle not coincident
(VGSI Angle 3.00/TCH 71).

One Minute Holding Pattern

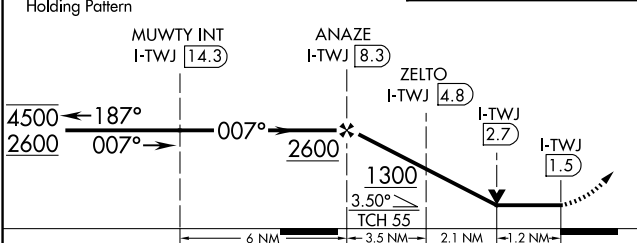

CATEGORY	A	B	C	D
S-LOC 1R	460/55	439 (500-1)	460-1¼	439 (500-1¼)
CIRCLING	600-1	574 (600-1)	680-1¾ 654 (700-1¾)	980-3 954 (1000-3)

