

APP CRS
259°

Rwy Ldg
TDZE
38

Apt Elev
38

RNAV (GPS) RWY 26

HILO INTL (ITO) (PHTO)

RNP APCH.

⚠


Circling NA south of Rwy 8-26. Rwy 26 helicopter visibility reduction below ¾ SM NA. WAAS VNAV NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 15°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to ¾ SM and increase LNAV Cat A/B visibility to 1 SM.

MALSR


⚠


MISSED APPROACH: Climb to 500 then climbing right turn to 4000 direct CABIX and hold, continue climb-in-hold to 4000.

ATIS 126.4	HILO APP CON* 119.7 269.2	HILO TOWER* 118.1(CTAF) 0 263.1	GND CON 121.9
---------------	------------------------------	------------------------------------	------------------

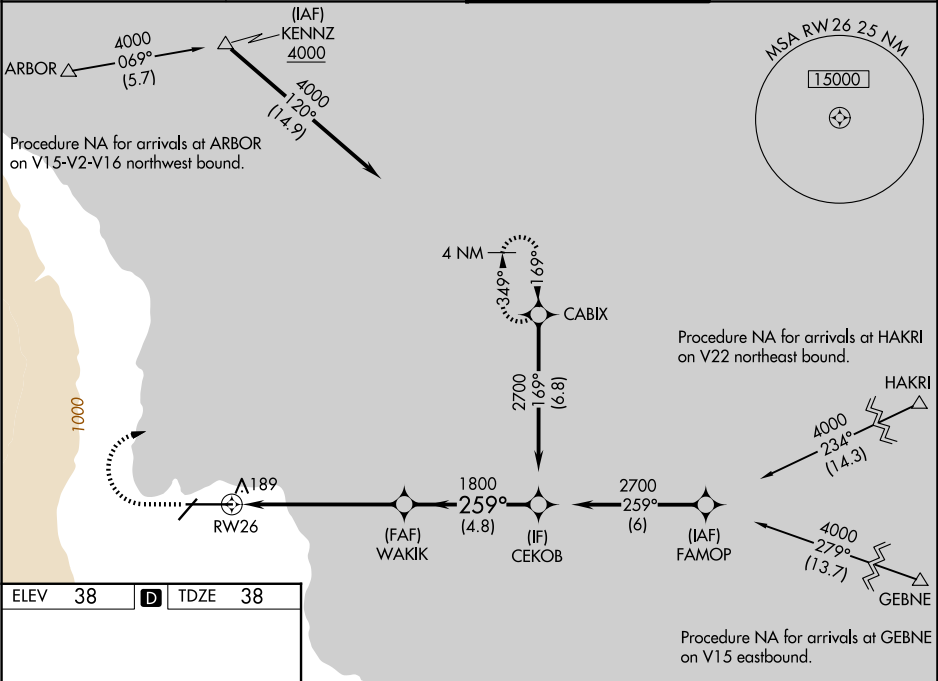

ELEV 38	D	TDZE 38
---------	---	---------

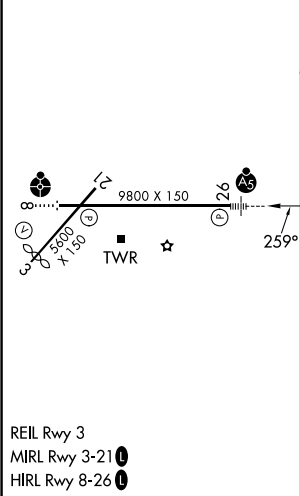

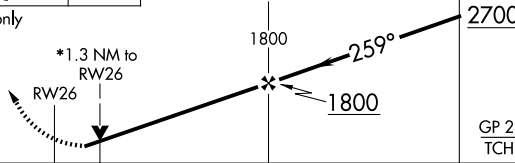500	4000	CABIX	VGSI and RNAV glidepath not coincident (VGSI Angle 2.60/TCH 70).			
						
*LNAV only			CEKOB			
*1.3 NM to RW26			WAKIK			
1.3			1800			
4.9 NM			2700			
4.8 NM			GP 2.60° TCH 56			
CATEGORY	A	B	C	D		
LNAV/ VNAV DA	350-¾ 312 (400-¾)					
LNAV MDA	460-¾ 422 (500-¾)					
CIRCLING	500-1 462 (500-1)	540-1 502 (600-1)	840-2¼ 802 (900-2¼)	1320-3 1282 (1300-3)		