

MARYSVILLE, CALIFORNIA

HI-ILS or LOC Z RWY 15

LOC I-BAB
109.5

APCH CRS
145°

Rwy Idg 12,001
TDZE 113
Arpt Elev 113

- (USAF)

BEALE AFB (KBAB)


RADAR or DME required

ALSF-1

MISSED APPROACH: Climb to 700 on heading 145°, then climbing right turn to 4400 heading 011° to intercept BAB R-326 to HAPAK and hold, continue climb in hold to 4400.

* When ALS inop, increase CAT CDE RVR to 40 and vis to 3/4 mile.
** When ALS inop, increase CAT CDE vis to 1 3/8 miles.

ATIS★ 124.55 273.5	NORCAL APP CON 125.4 259.1	TOWER★ 119.4 284.75	GND CON 121.6 257.75
-----------------------	-------------------------------	------------------------	-------------------------

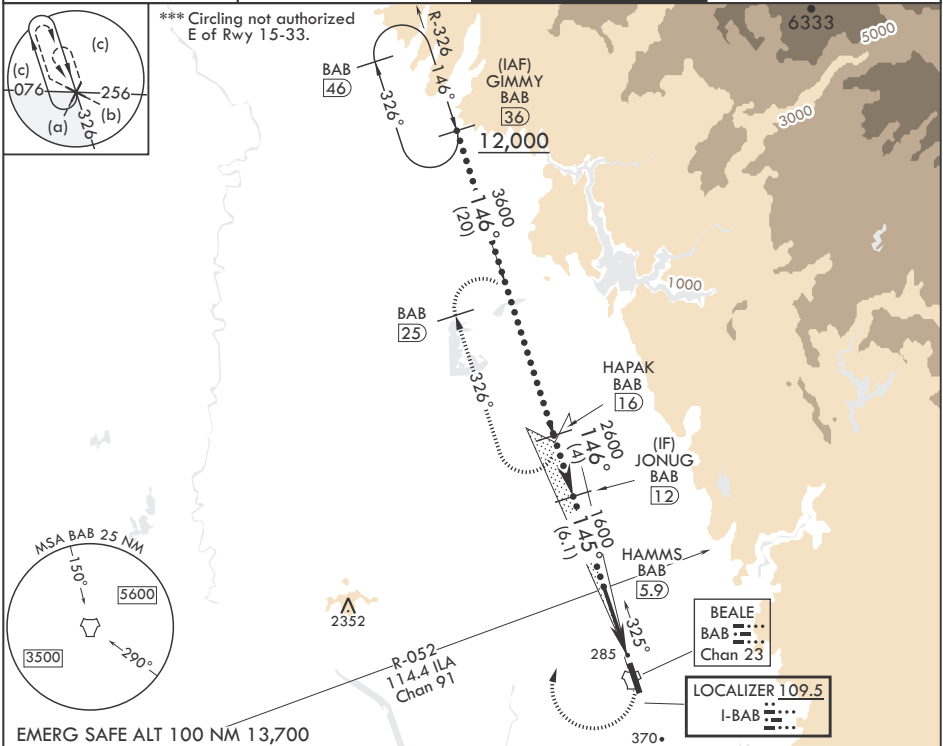

JONUG BAB 12	VGSI and glideslope not coincident. (VGSI Angle 2.75/TCH 53)	700	4400	BAB R-326	ELEV 113	TDZE 113
2600	145°	1600	4.5 NM	0.5	145°	145°
GS 2.75° TCH 47	HAMMS BAB 5.9	BAB 2.5	BAB HEGOP 1.5	BAB TACAN	BCN 240	TWR 274
CATEGORY	C	D	E			
S-ILS 15*	313/24	200	(200-1/2)			
S-LOC 15**	600/50	487	(500-1)			
CIRCLING***	600-1 1/2 487 (500-1 1/2)	800-2 1/4 687 (700-2 1/4)	800-2 1/2 687 (700-2 1/2)			