

YIGO, GUAM I, GUAM

TACAN Z RWY 24R

TACAN UAM Chan 54	APCH CRS 231°	Rwy Idg 10,528 TDZE 617 Arpt Elev 617
-----------------------------	-------------------------	--

- (USAF)

ANDERSEN AFB (PGUA)

RADAR or DME required.

T * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.
** Circling not authorized NW of Rwy 06L-24R.


ALS
A₁

MISSED APPROACH: Climb to 1100, then climbing left turn to 3000 to intercept UAM R-051 to FOVEM and hold.

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8	CLNC DEL 126.725 256.7
-------------------------	-------------------------------------	----------------------	------------------------	---------------------------

CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

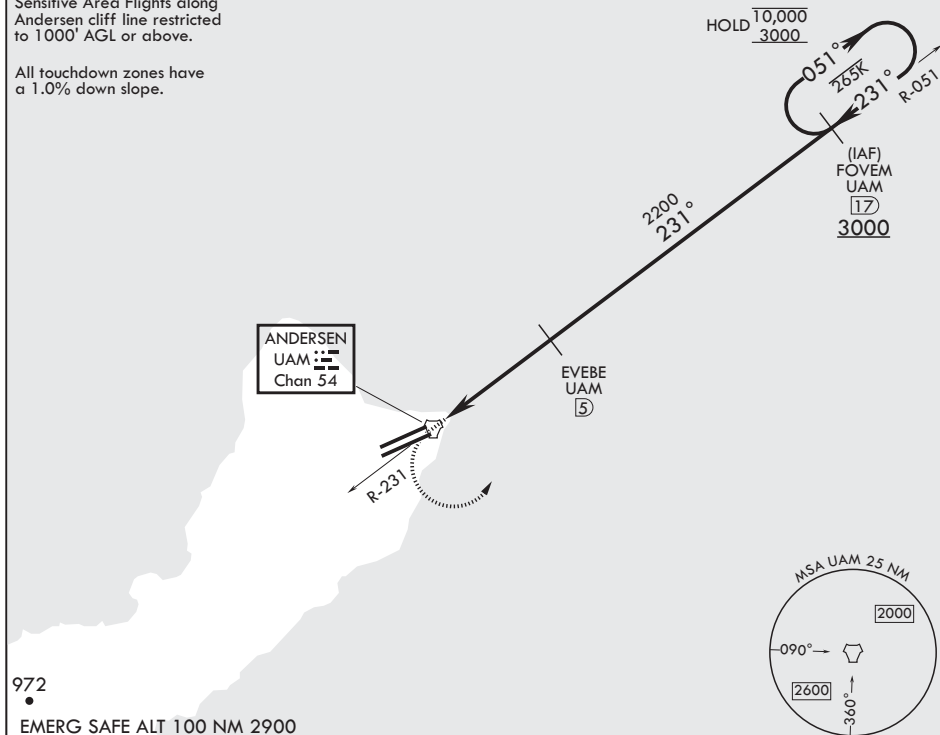

1100 **3000** **FOVEM** **VGSIs and ILS glidepath not coincident (VGS angle 3.00/TCH 59).** **UAM R-051** **UAM 17** **FOVEM 17** **EVEBE 5** **2200** **051°** **231°** **10,000** **3000**

TACAN **JIPRO 5** **≤ 2.79° TCH 59** **0.7** **4.5 NM**

CATEGORY **A** **B** **C** **D** **E**

S-24R* **940/24 323 (400-½)** **940/40 323 (400-¾)**

CIRCLING** **1060-1 443 (500-1)** **1080-1 463 (500-1)** **1240-1¾ 623 (700-1¼)** **1240-2 623 (700-2)** **1240-2¼ 623 (700-2¼)**

ELEV 617 **TDZE 617** **x10,528 x 200 -0.7% DOWN** **x 11,200 x 200 0.4% UP** **TWR BCN 735** **HIRL all Rwys**

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21
TERPS

TACAN Z RWY 24R