

HAYWARD, CALIFORNIA

AL-5015 (FAA)

25219

WAAS CH 40330 W28A	APP CRS 285°	Rwy Ldg 5018 TDZE 50 Apt Elev 52
--	------------------------	---

RNAV (GPS) RWY 28L
HAYWARD EXEC (HWD)


RNP APCH - GPS.

T Baro-VNAV NA. Circling Rwy 10L, 28R NA at night. Rwy 28L helicopter visibility reduction below $\frac{3}{4}$ SM NA. When local altimeter setting not received, use OAK altimeter setting and increase LPV DA to 370 feet; increase LNAV/VNAV DA to 461 feet; increase all MDAs 40 feet and LNAV visibility Cat C/D $\frac{1}{4}$ SM, and Circling visibility Cat D $\frac{1}{4}$ SM. Circling NA north of Rwy 10L-28R.


MISSED APPROACH: Climb to 600 then climbing right turn to 2100 direct OAK VOR/DME and hold.

ATIS 126.7	NORCAL APP CON 124.4 351.8	HAYWARD TOWER* 120.2 (CTAF) 0 257.8	GND CON 121.4	CLNC DEL 128.05	UNICOM 122.95
---------------	-------------------------------	--	------------------	--------------------	------------------

MISSED APCH FIX

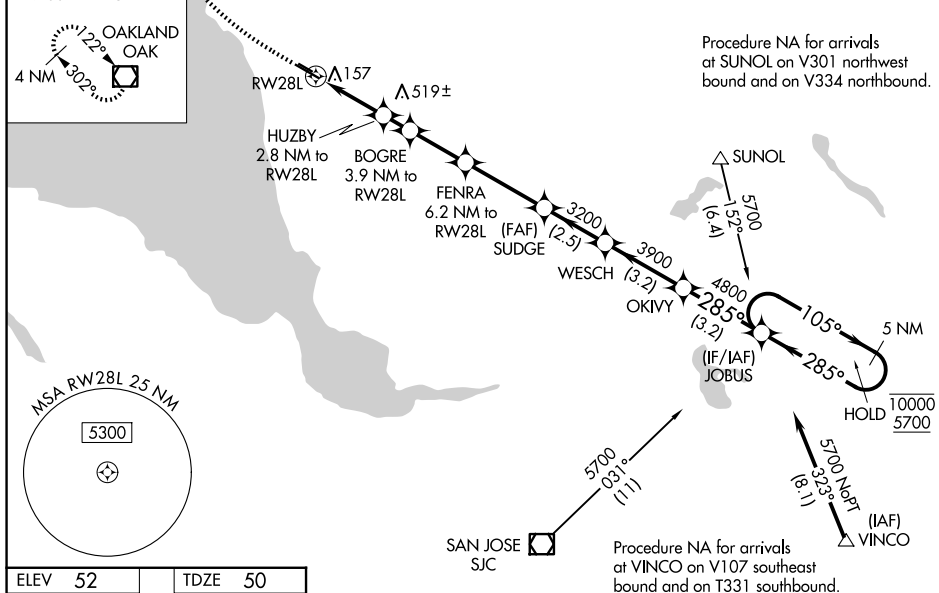

ELEV 52		TDZE 50
---------	--	---------

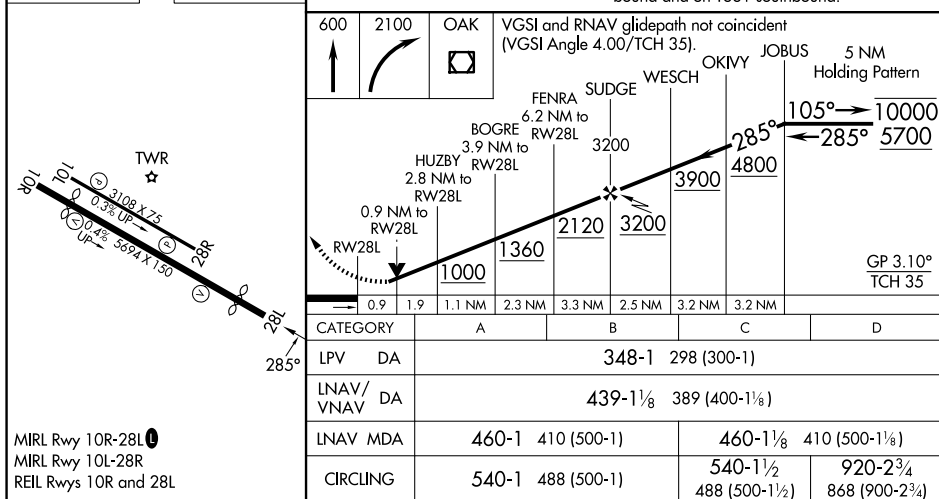

HAYWARD, CALIFORNIA

Amdt 1E 20FEB25

37°40'N-122°07'W

HAYWARD EXEC (HWD)

RNAV (GPS) RWY 28L

SW-2, 30 OCT 2025 to 27 NOV 2025