

APP CRS	Rwy Ldg	10000
087°	TDZE	91
	Apt Elev	96

RNAV (RNP) Y RWY 9
GEORGE BUSH INTCNL/HOUSTON (IAH)



For uncompensated Baro-VNAV systems, procedure NA below -3°C (27°F) or above 54°C (130°F). GPS required. For inop MALSR, increase all Cats visibility to 1½ mile. Simultaneous approach authorized. Use of FD or AP providing RNAV track guidance required during simultaneous operations.

MALS




MISSED APPROACH: Climb to 580 then climbing right turn to 3000 direct JEBOX and hold.

D-ATIS
124.05

HOUSTON APP CON
120.05 379.1 E
124.35 316.15 W

HOUSTON TOWER
135.15 290.2

GND CON
118-575

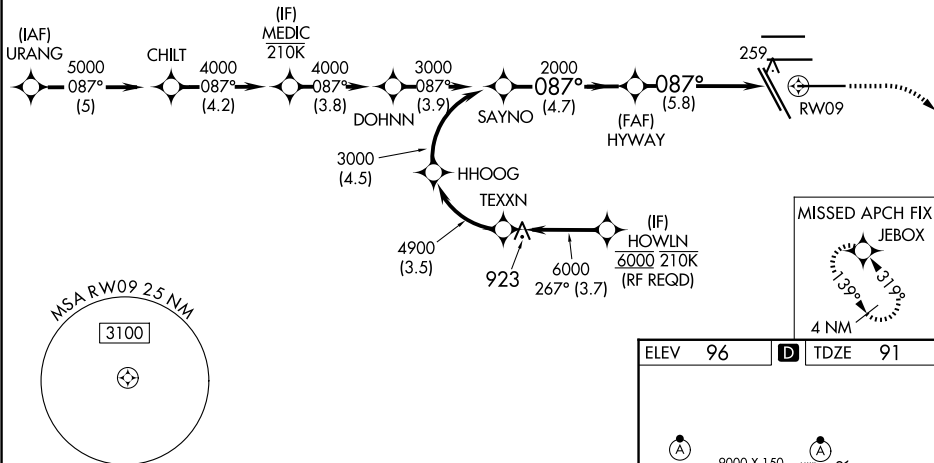

MISSED APCH FIX
JEBOX

4 NA

ELEV	96	D	TDZE	91
------	----	----------	------	----

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 71).

58C

30

JEB0

✓ (A5)

SAYNO

HYWAY

3000

20

GP 3.00

--	--

3. DIM_____

5

1

RNP 0.30 DA

516/49 425 (500-1)

AUTHORIZATION REQUIRED

TDZ/CL Rwy's 8R, 8L, 15R, 26R, 26L,
27 and 33L
HIRL all Rwy's

HOUSTON, TEXAS
Orig-B 13SEP18

GEORGE BUSH INTCNL/HOUSTON (IAH)
RNAV (RNP) Y RWY 9

29°59'N-95°20'W

RNAV (RNP) Y RWY 9